



File in Section: -

Bulletin No.: PI0660

Date: February, 2012

Service Bulletin

PRELIMINARY INFORMATION

Subject: Malfunction Indicator Lamp (MIL) Intermittent Illumination, Throttle Body Outside Air Inlet Duct Cracks

Models: 2009-2011 Chevrolet Aveo
2009 Pontiac G3
2009 Pontiac G3 Wave (Canada)
2010 Pontiac G3 (Canada)
Equipped with Engine RPO LXV

Condition/Concern

Some customers may comment on an intermittent illuminated malfunction indicator lamp (MIL). This condition may be caused by cracks in the throttle body (TB) outside air inlet duct.

Recommendation/Instructions

If a vehicle is encountered with the above MIL and/or engine driveability symptoms, a close visual inspection of the TB outside air inlet duct is needed.

1. Turn OFF the ignition.
2. Disconnect the battery negative cable. Refer to Battery Negative Cable Disconnection and Connection in SI.
3. Disconnect the breather hose from the TB outside air inlet duct, if equipped.
4. Loosen the air cleaner assembly and TB clamps, then disconnect and remove the TB outside air inlet duct.





2754649



2755487

5. Manipulate the TB outside air inlet duct while performing a visual inspection for any cracks, separations or deterioration as shown.
 - ⇒ If any cracks, separation or deterioration are observed, replace the TB outside air inlet duct.
6. Install and tighten the air cleaner assembly and TB clamps.
7. Connect the breather hose to the TB outside air inlet duct, if equipped.
8. Connect the battery negative cable. Refer to Battery Negative Cable Disconnection and Connection in SI.
9. Turn ON the ignition.
10. Clear any DTCs with a scan tool.

Warranty Information

For vehicles repaired under warranty, use:

Labor Operation	Description	Labor Time
J5020	Duct And/Or Hose, Outside Air - Replace	0.3 hr