



# Service Bulletin

File in Section: -

Bulletin No.: PIT4952B

Date: February, 2012

## PRELIMINARY INFORMATION

**Subject:** Intermittent SIR Light On No Communications With The PPS DTC U0170

**Models:** 2010 - 2012 Chevrolet Equinox  
2010 - 2012 GMC Terrain

**This PI was superseded to update model and model years. Please discard PIT4952A.**

The following diagnosis might be helpful if the vehicle exhibits the symptom(s) described in this PI.

### **Condition/Concern:**

Some customers may complain of an intermittent SIR light coming on. During diagnosis a DTC U0170 may be found as a current or history code. This may be due to poor connections at the JX202 connector.

### **Recommendation/Instructions:**

Inspect the JX202 for a poor connection or broken wire crimp at the terminal. This is located in the passenger compartment, at the left side of the instrument panel, taped to the body harness. Repair JX202 circuit 5060 as needed.

Please follow this diagnostic or repair process thoroughly and complete each step. If the condition exhibited is resolved without completing every step, the remaining steps do not need to be performed.