



NUMBER: 14-001-12

GROUP: Fuel System

DATE: January 20, 2012

This bulletin is supplied as technical information only and is not an authorization for repair. No part of this publication may be reproduced, stored in a retrieval system, or transmitted, in any form or by any means, electronic, mechanical, photocopying, or otherwise, without written permission of Chrysler Group LLC.

SUBJECT:

Fuel Spit Back During Refueling Due To Faulty Inlet Check Valve X39 (Unlimited Time And Mileage Warranty Extension)

OVERVIEW:

This bulletin involves replacing the fuel filler tube if the condition occurs.

MODELS:

| | | |
|-------------|------|---------|
| 2006 - 2008 | (HB) | Durango |
| 2007 - 2008 | (HG) | Aspen |

NOTE: This Extended Warranty Bulletin applies to vehicles equipped with a naturally aspirated gasoline engines.

SYMPTOM/CONDITION:

Some customers may experience a fuel spit back condition during a refueling event.

DIAGNOSIS:

If the customer experiences the symptom/condition, proceed to the repair procedure.

PARTS REQUIRED:

| Qty. | Part No. | Description |
|--------|------------|--------------------------------|
| AR (1) | CNNZX390AA | Tube, Fuel Filler |
| (4) | 6500911 | Rivet, Splash Shield Attaching |

REPAIR PROCEDURE:

1. Hoist vehicle.
2. Remove Left rear wheel.
3. Remove the left quarter panel splash shield. There are 4 plastic retaining rivets.

CAUTION: Protect Paint and Quarter panel medal during removal and installation.

4. Replace the fuel filler tube, Following the detailed procedures found in DealerCONNECT>TechCONNECT Service Info > 14 - Fuel System> Fuel Delivery > Tube, Fuel Filler removal and installation procedures.
5. Install the left quarter panel splash shield. There are 4 plastic retaining rivets.
6. Install left rear wheel.

POLICY:

Reimbursable within the provisions of the warranty.

NOTE: Vehicles included in this Service Bulletin have a lifetime coverage - Unlimited Time and Mileage warranty for this repair. See Warranty Bulletins; U.S. D-12-07, Canada SAB 2012-03, International ID-12-02 or Mexico BG-01-12 for details associated with the extended warranty.

TIME ALLOWANCE:

| Labor Operation No: | Description | Amount |
|----------------------------|--|---------------|
| 14-60-15-92 | Tube, Fuel Filler Replace (C) (Skill Level = B; Training Level = 3) | 0.6 Hrs. |

FAILURE CODE:

| | |
|----|----------------|
| ZZ | Service Action |
|----|----------------|