



Service Bulletin

File in Section: -

Bulletin No.: PIT4925A

Date: February, 2012

PRELIMINARY INFORMATION

Subject: SIR Light On DTC B001A And/Or B001B

Models: 2010 - 2011 Chevrolet Equinox
2010 - 2011 GMC Terrain

This PI was superseded to update model and model years. Please discard PIT4925.

The following diagnosis might be helpful if the vehicle exhibits the symptom(s) described in this PI.

Condition/Concern:

The SIR light is on with DTC B001A and/or B001B with symptom code 02, 04, 0D, or 0E set in the SDM. This code is for the front seat belt anchor tensioner – located on the outboard side of the driver or passenger seat. This concern may be caused by a shorted wire behind the plastic trim on the side of the seat.

Recommendation/Instructions:

Remove the plastic trim on the outboard side of the appropriate seat. Inspect the harness for the pretensioner for any cuts or chaffed wires. It may be necessary to move the seat through its full range of movement and look for any areas that the wires harness may be getting pinched or chaffed. Repair the wires as necessary and reroute the wires to prevent any further chaffing.

Please follow this diagnostic or repair process thoroughly and complete each step. If the condition exhibited is resolved without completing every step, the remaining steps do not need to be performed.