

UPDATE Technical Bulletin



24 12 01 March 13, 2012 2028829

UPDATE – 24W2 Intake Flap Motor

NOTE:

- Perform this UPDATE on all applicable vehicles within Intake Manifold Runner Control Warranty Ext(10 years or 120,000 miles (192,000km), whichever occurs first)
- It is MANDATORY to perform UPDATES on all applicable vehicles in dealer inventory PRIOR TO RETAIL SALE.
- Inform customers that this UPDATE will be available free of charge as long as their vehicle is within the Warranty parameters outlined in this UPDATE.

NOTE:

Required DMS Wording/Programming Text (SAGA claim comments): UPDATE Code 24W2 Intake Flap Motor

Model(s)	Year	Engine Code	Trans. Code	From	To
Jetta	2006 - 2008	2.0L (BPY)	All	3VW__1K_6M600925	3VW__1K_6M044469
Eos	2006 - 2008	2.0L (BPY)	All	WVW__1F_6V000336	WVW__1F_6V017093
GTI	2006 – 2008	2.0L (BPY)	All	WVW__1K_6W017326	WVW__1K_8W102058
Passat	2006 – 2008	2.0L (BPY)	All	WVW__3C_6_002717	WVW__3C_8_080809

REVISION HISTORY

Revision	Date	Purpose
1	03/06/2012	Original publication
2	03/13/2012	Updated Note section,

Technical Background

The Intake Flap Motor -V157- or Intake Manifold Runner Position Sensor -G336- may be inoperative. (Both are included in one single assmebly.)



Production Solution

Improved the manufacturing process for the Intake Flap Motor -V157- and Intake Manifold Runner Position Sensor -G336-.

Service

NOTE:

- *ElsaWeb is the only valid inquiry/verification source. Check ElsaWeb on the day this vehicle UPDATE will be performed to verify vehicle eligibility for the UPDATE. Status must show "open". Attach an ElsaWeb printout showing the "open" status to the repair order.*
- *If this UPDATE appears to have already been performed but the code still shows open in ElsaWeb, contact Warranty before proceeding further. Another dealer may have recently performed this UPDATE but not yet entered a claim for it in the system.*
- *ElsaWeb may also show additional open action(s); if so, inform your customer - this work can be done while the vehicle is in for this UPDATE.*
- *Contact the Warranty Helpline (U.S.) or the Warranty Campaign Specialist (Canada) if you have any questions.*



Figure 1. Part Number Location on The Intake Flap Motor V157. P/N 06F 133 482 E should be installed.

- Locate the Intake Flap Motor V157
- If the Intake Flap Motor V157 part number **IS**, **06F 133 482 E**, no further work is required
- If the Intake Flap Motor V157 part number **IS NOT**, **06F 133 482 E**, replace the Intake Flap Motor and perform basic seating Channel 142.

UPDATE Technical Bulletin



Required Parts and Tools

Part Description	Part No:	Quantity
Intake Flap Motor	06F 133 482 E	1

Tool Description	Tool No:
Midtronics Battery Tester/Charger	InCharge 940 (INC-940)
VAS Diagnostic Tool	VAS 5051B, 5052/A, 6150 (Base CD V19.00, Brand DVD V19.10.00 or higher)

Warranty

Claim Entry Procedure	Enter your claim immediately upon completion of the UPDATE. Claims will only be paid for vehicles that show this UPDATE code open in ElsaWeb on the day of repair. To help ensure prompt and proper payment, attach the screen print to the repair order.
Claim Help	<u>U.S. dealers</u> - Contact the Warranty Helpline toll-free at 1-866-306-8447 for help with claim entry. <u>Canadian dealers</u> - Contact your Warranty Campaign Specialist. For contact information, please proceed to "ServiceNet – Warranty/Contact Information/Campaigns – "Warranty Campaign Specialist."
Required Customer Notification	Ensure customers are aware of all work performed on the vehicle by recording the information on the repair order. Attach a copy of the <i>Vehicle UPDATE Fact Sheet</i> to the customer's copy of the repair order and take the time to explain this UPDATE to your customer.

UPDATE Technical Bulletin



SAGA Code 24W2 Claim Entry Procedure

Check ElsaWeb to confirm that this UPDATE code is open on the day of repair.

Service No.: 24W2

Damage Code: 0099

Parts Manufacturer/Vendor Code: WWO

Claim Type

Sold vehicle = 7 10

Unsold vehicle = 7 90

Accounting Instructions

Criteria I.D. 01 Check/UPDATE present. No further work required.

Repair operation: 0183 00 99 10 TU

-- OR --

Criteria I.D. 01 Replace Intake Flap Motor

Repair operation: 2465 19 99 80 TU

<u>Quantity</u>	<u>Part Number</u>	<u>Part Description</u>
1	06F133482E	Intake Flap Motor

There is NO reimbursement for wash or loaner vehicle!

If vehicle is not eligible for repair under this UPDATE (i.e.: totaled status) OR if customer refused repairs.

Fax the Repair Order to VWoA at (248) 754-5093 and provide VIN, applicable Service Number, Customer Information, Dealer Number and Date

Additional Information

All part and service references provided in this Technical Bulletin are subject to change and/or removal. Always check with your Parts Dept. and Repair Manuals for the latest information.

UPDATE Technical Bulletin



UPDATE FACT SHEET – UPDATE Code 24W2

Dear Volkswagen Customer,

Today we performed UPDATE code 24W2 on your vehicle. This UPDATE replaces the intake flap motor, and was performed for you free of charge.

Volkswagen periodically makes updates like this available in order to ensure our customer's continued satisfaction with the quality of their Volkswagen vehicles.

We at Volkswagen are committed to providing our customers with reliable, quality products that are a pleasure to drive and own. If you should ever have any questions or vehicle concerns, your authorized Volkswagen dealer will be pleased to assist you.

Thank you for driving a Volkswagen!