



Service Bulletin

File in Section: -

Bulletin No.: PIC5651

Date: March, 2012

PRELIMINARY INFORMATION

Subject: Intermittent Service Power Steering Message With DTC U0131

Models: 2011 - 2012 Buick Lacrosse
2012 Buick Regal
2013 Chevrolet Malibu
With NJ1

The following diagnosis might be helpful if the vehicle exhibits the symptom(s) described in this PI.


Condition/Concern:

Condition: A customer or technician may comment about an intermittent "Service Power Steering" message. DTC U0131 may also be set current or in history when checking for DTC's with a scan tool.

Recommendation/Instructions:

Cause: Loose B+ feed at the X50A Underhood Fuse Block or the 80A fuse retaining bolts in the UHFB. Battery feed is X6 on LaCrosse and Malibu and X8 on Regal, loose G111. Please refer to SI for your vehicle.

Correction: Secure B+ feed or fuse nuts as needed. Check G111.

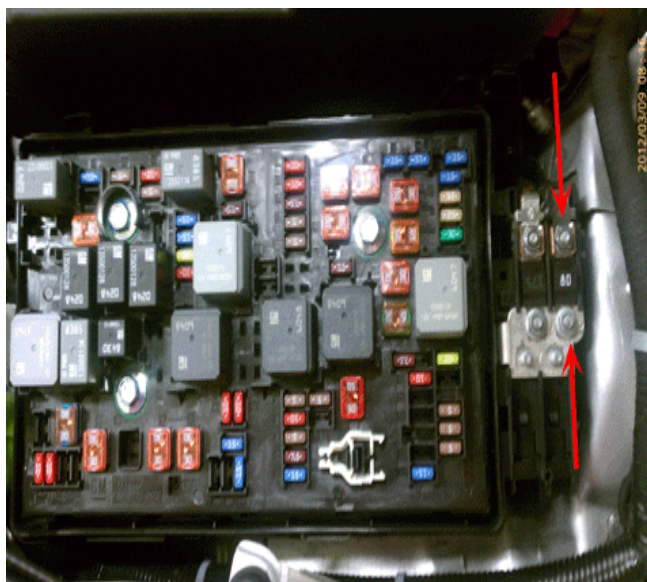

2790193

(2013 Chevrolet Malibu shown)

Please follow this diagnostic or repair process thoroughly and complete each step. If the condition exhibited is resolved without completing every step, the remaining steps do not need to be performed.