

SB-10044066-3037

Countries:	CANADA, UNITED STATES	Document ID:	IK0100025
Availability:	ISIS, FleetISIS, Body Builder	Revision:	4
Major System:	FRAME AND BUMPER	Created:	4/30/2012
Current Language:	English	Last Modified:	5/1/2012
Other Languages:	Français , Español ,	Author:	Simon Marcoux
Viewed:	300		

[Less Info](#)

Hide Details

Coding Information

Copy Link	Copy Relative Link	Bookmark	Add to Favorites	Print	Provide Feedback	Helpful	Not Helpful
		 View My Bookmarks				 74	 53

Title: Block Heater Element Hitting the Front Crossmember**Applies To: 7600 with 2010 EPA Maxx Force 11 and 13 with feature code 0012864**

DESCRIPTION

The below information is the repair for the block heater element coming in contact with the front crossmember.

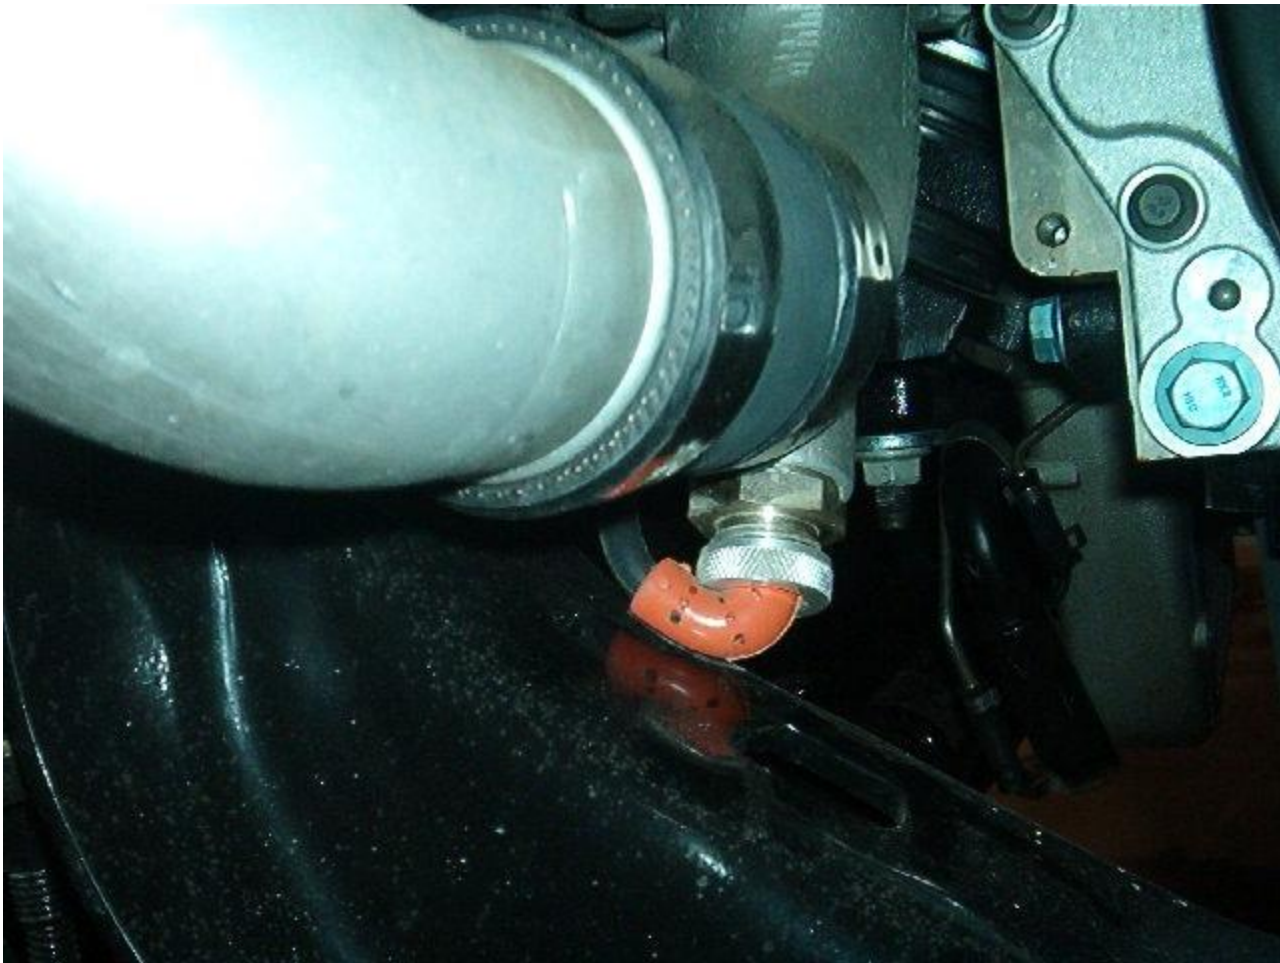


Figure 1

PARTS INFORMATION

Part #	Description	Qty.
3727831C2	Bracket	1
3727832C2	Bracket	1

RESOLUTION

The brackets for the front crossmember (items 2 and 3 in figure 2) need replaced with the above provided C2 part numbers. The new C2 brackets have the holes for the crossmember mounting placed lower. This lowers the crossmember increasing the clearance from the block heater element.

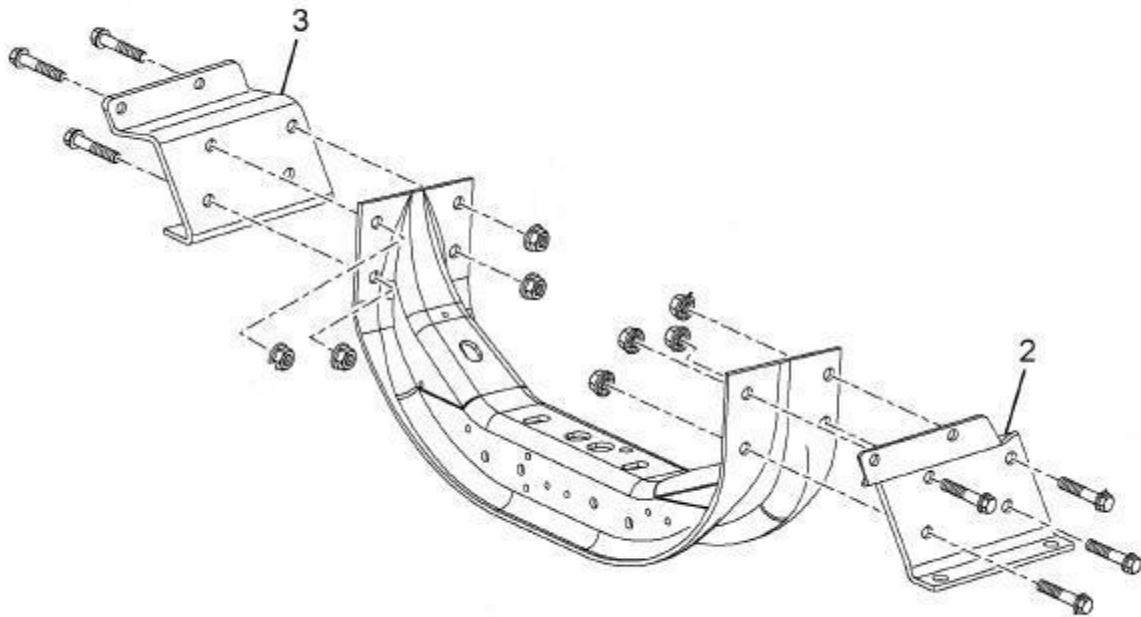


Figure 2

Special thanks to Inter Outaouais, Inc. Papineauville Quebec, Charles Roy and Alain Ferlatte.

 Hide Details

Feedback Information

Viewed: 299

Helpful: 74

Not Helpful: 53

No Feedback Found

Copyright © 2012 Navistar, Inc.