



Hydraulic Brake Interlock Circuit Protection

BULLETIN

Models Affected: Certain 2011-2013 Model Year Vision, With Hydraulic Brake Interlock

ISSUE

Certain 2011-2013 model year Vision buses equipped with hydraulic brake interlock feature may have incorrect circuit protection installed. This can lead to premature circuit breaker tripping.

CORRECTIVE ACTION

Verify correct circuit protection installed. If required replace circuit protection. See the verification and replacement instruction below.


PROCEDURE

1. Park the bus on a level surface, apply parking brakes, turn off engine and remove keys. Chock wheels.
2. Remove chassis Power Distribution Unit (PDU) cover by removing two thumb screws. The thumb screws are located at the top of each side of the cover.
3. Verify fuse or breaker installed in fuse block (FB2) position (2). See decal on reverse side of PDU cover for location. It will be listed as "HYD INTERLOCK POWER". If a 25 amp fuse is installed no action is required, replace cover. If not a 25 amp fuse, replace with Blue Bird 25 amp fuse part number 01983832 and correct existing decal with the new overlay decal (provided).



Thumb screws.
Cover is located
lower center of
dash.

See Decal

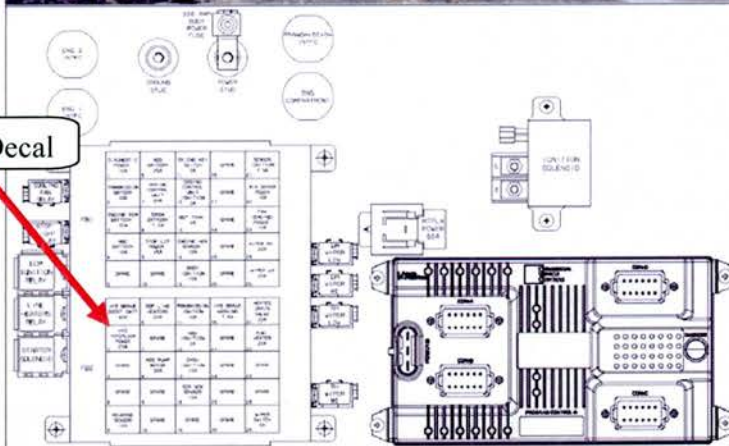

S I 2 T Z

S E R V I C E B U L L E T I N



May 24, 2012

Dear Blue Bird Owner,

Certain 2011-2013 model year Vision buses equipped with hydraulic brake interlock feature may have incorrect circuit protection installed. Incorrect circuit protection can lead to premature circuit breaker tripping. Instructions for inspecting and, if needed, correction of the circuit breaker protection are provided in Service Bulletin S12TZ. (Copy attached)

Your buses affected by Service Bulletin S12TZ are identified by Blue Bird body number on the enclosed cover sheet.

We have included a supply of 25 amp fuses and replacement decals with this mailing for your use, if needed.

You may contact your Blue Bird dealer to arrange to have Service Bulletin S12TZ performed. Or, if you prefer, you may perform Service Bulletin S12TZ yourself or have a qualified repair facility convenient to you perform this service bulletin. A qualified technician should perform Service Bulletin S12TZ.

Time to inspect and, if necessary, install replacement 25 amp fuse and decal according to Service Bulletin S12TY is 0.25hrs (15 minutes) per bus.

Service Bulletin S12TZ ends one (1) year from date of issue. Claims for repairs performed after the end date cannot be submitted to Blue Bird.

Should you have any questions concerning this bulletin, please contact your Blue Bird dealer.

Sincerely,

Bill Coleman
Engineering Services
478-822-2242
bill.coleman@blue-bird.com

BLUE BIRD BODY COMPANY

P.O. Box 937 – 402 Blue Bird Blvd – Fort Valley, Georgia – (478) 825-2021