

**IMPORTANT SERVICE
INFORMATION FOR:**

- ✓ SERVICE MANAGER
- ✓ SERVICE ADVISOR
- ✓ TECHNICIAN
- ✓ PARTS DEPARTMENT
- ✓ WARRANTY PERSONNEL

BULLETIN NUMBER:
IB11-J-005A

ISSUE DATE:
MAY 2012

GROUP:
ENGINE

TURBOCHARGER ENGINE UNDER BOOST – REPROGRAM ECM

AFFECTED VEHICLES

- 2011-2012MY Isuzu N-Series
Equipped with 3.0L 4JJ1 Diesel Engine

This bulletin supersedes IB11-J-005. This updated bulletin provides updated model year and calibration information. Please discard bulletin IB11-J-005.

INFORMATION

Some customers may experience a Malfunction Indicator Lamp illuminated with a history of DTC P0299 set in the engine control module (ECM). Follow the diagnostics for this code. If no fault can be found during normal diagnosis, follow the service procedure below to correct this concern.

SERVICE PROCEDURE

Reprogram the ECM with the latest software and calibrations using the Isuzu Diagnostic Service System (IDSS) if the calibration part number is NOT listed below:

Vehicle	Model Year	Corrected Calibration #
NPR	2011	98213673 or higher
NPR	2012	98213670 or higher
NPR Stripped Chassis	2012	98213672 or higher

WARRANTY INFORMATION

For vehicles still covered under the basic warranty, use:

Labor Operation	Description	Labor Time
J8001	IB11-J-005 4JJ P0299 Reprogram	0.4