

NUMBER: 14-003-12

GROUP: Fuel System

DATE: May 25, 2012

This bulletin is supplied as technical information only and is not an authorization for repair. No part of this publication may be reproduced, stored in a retrieval system, or transmitted, in any form or by any means, electronic, mechanical, photocopying, or otherwise, without written permission of Chrysler Group LLC.

THIS BULLETIN SUPERSEDES SERVICE BULLETIN 14-001-11, DATED FEBRUARY 11, 2011, WHICH SHOULD BE REMOVED FROM YOUR FILES. THIS IS A COMPLETE REVISION AND NO ASTERISKS HAVE BEEN USED TO HIGHLIGHT REVISIONS.

SUBJECT:

Fuel Spit Back During Refueling (X32 Warranty Extension Unlimited Time And Mileage)

OVERVIEW:

This bulletin involves replacing the fuel tube at the fuel tank. This new fuel tube has a check valve.

MODELS:

2007 - 2008 (JK) Wrangler

NOTE: This Extended Warranty Bulletin applies to vehicles equipped with a 3.8L engine (sales code EGT) built between March 1, 2007 (MDH0301XX) and March 31, 2008 (MDH 0331XX).

SYMPTOM/CONDITION:

Some customers may experience a fuel spit back condition during a refueling event.

DIAGNOSIS:

If the customer experiences the symptom/condition, proceed to the repair procedure.

PARTS REQUIRED:

Qty.	Part No.	Description
(1)	CNNNX321AC	Tube, Fuel
(2)	06016076	Strap, tie Every vehicle will need two

REPAIR PROCEDURE:

1. Open Hood.
2. Disconnect and isolate negative battery cable.
3. Remove fuel cap.
4. Hoist vehicle.
5. Cut the tie straps holding the recovery line to the fuel tube.
6. Remove the fuel tube and discard(Fig. 1).

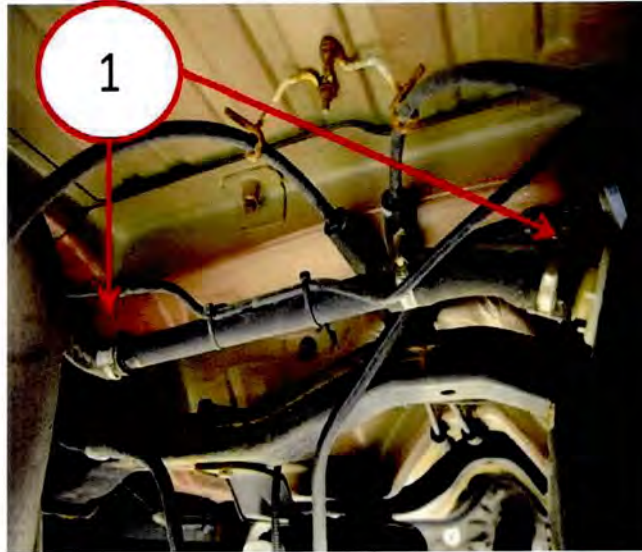


Fig. 1 Fuel Line

1 - Fuel Tube Clamps

7. Install the fuel tube (CNNX321ac) and torque clamps to 3 N·m (30 in. lbs).
8. Tie strap (06016076) recovery line to fuel tube in tow places (Fig. 1).

POLICY:

Reimbursable within the provisions of the warranty.

NOTE: Vehicles included in this Service Bulletin have a lifetime coverage - Unlimited Time and Mileage warranty for this repair. See Warranty Bulletins; U.S. D-11-05, Canada SAB-2011-03 or International ID-11-01 for details associated with the extended warranty.

TIME ALLOWANCE:

Labor Operation No:	Description	Amount
14-60-15-93	Tube, Fuel Replace (Skill Level = C; Training Level = 2)	0.3 Hrs.

FAILURE CODE:

ZZ	Service Action
----	----------------