

Door cannot be closed/not engaging

Topic number	LI72.10-P-053599
Version	1
Design group	72.10 Front door
Date	06-27-2012
Validity	197.377
Reason for change	
Reason for block	

Complaint:

Door cannot be closed/intermittently not engaging.

Cause:

Plastic covering on rotary tumbler of door lock damaged/torn.

Remedy:

Rework covering on rotary tumbler of door lock:

- Move lock to pre-lock position (1st detent) (see Figure 1)
- Cut all round plastic covering of rotary tumbler using a sharp knife (see Figure 2-4). Run the knife along the side of the lock housing as a guide

Note: The coating on the metallic surface must not be damaged

- Remove cut covering from lock opening using pliers (Figure 5)

Note: Make sure that no debris is left in the lock; tap out the lock if necessary

Attachments	
File	Designation
Bild 1.JPG	Figure 1
Bild 2.JPG	Figure 2
Bild 3.JPG	Figure 3
Bild 4.JPG	Figure 4
Bild 5.JPG	Figure 5

Symptoms
Jammed / Overall vehicle / Safety and locking system / Locks/locking/Remote closing mechanism /
Overall vehicle / Stiff/sluggish / Safety and locking system / Locks/locking/Remote closing mechanism /
Stiff movement/jammed / Body / Door / Door/Flap / Door /
Does not close / Overall vehicle / Safety and locking system / Locks/locking/Remote closing mechanism /
Overall vehicle / Hooks / Safety and locking system / Locks/locking/Remote closing mechanism /

Work units

# XENTRY

Op. no.	Operation text	Time	Damage code	Note
72-4360	REWORK LEFT DOOR LOCK		72B11 H2	
72-4370	REWORK RIGHT DOOR LOCK		72P11 H2	

Validity		
Vehicle	Engine	Transmission
197.377	159.980	*

Full model designation breakdown		
Vehicle	Engine	Transmission
197.377	159.980	700.400

## Attachments

Bild 1.JPG:

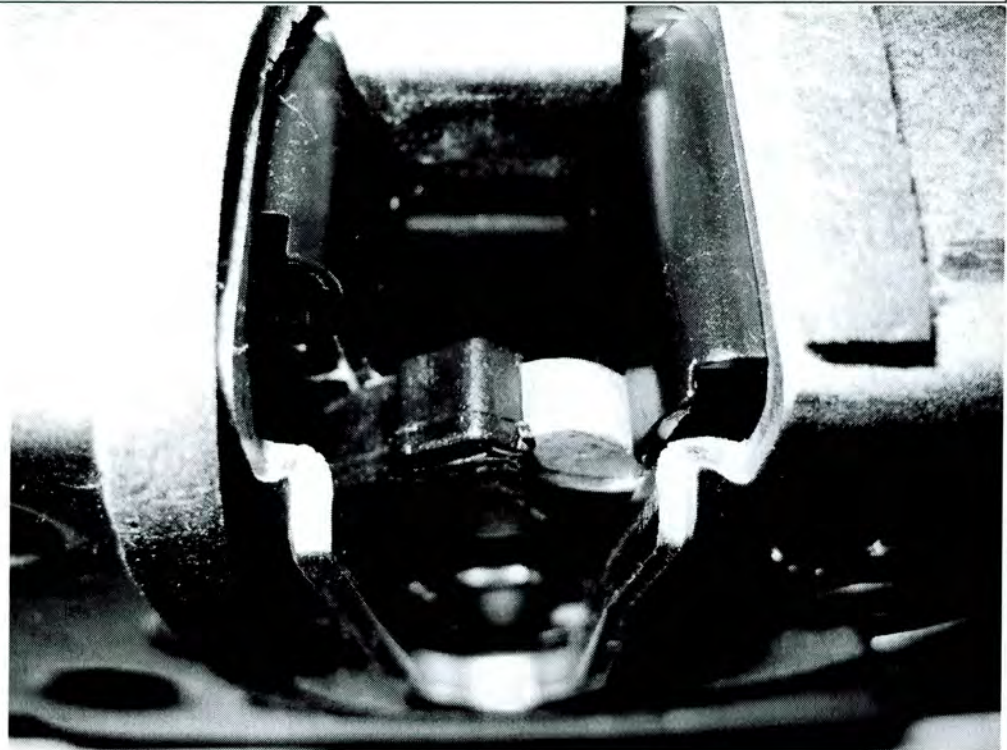


Bild 2.JPG:

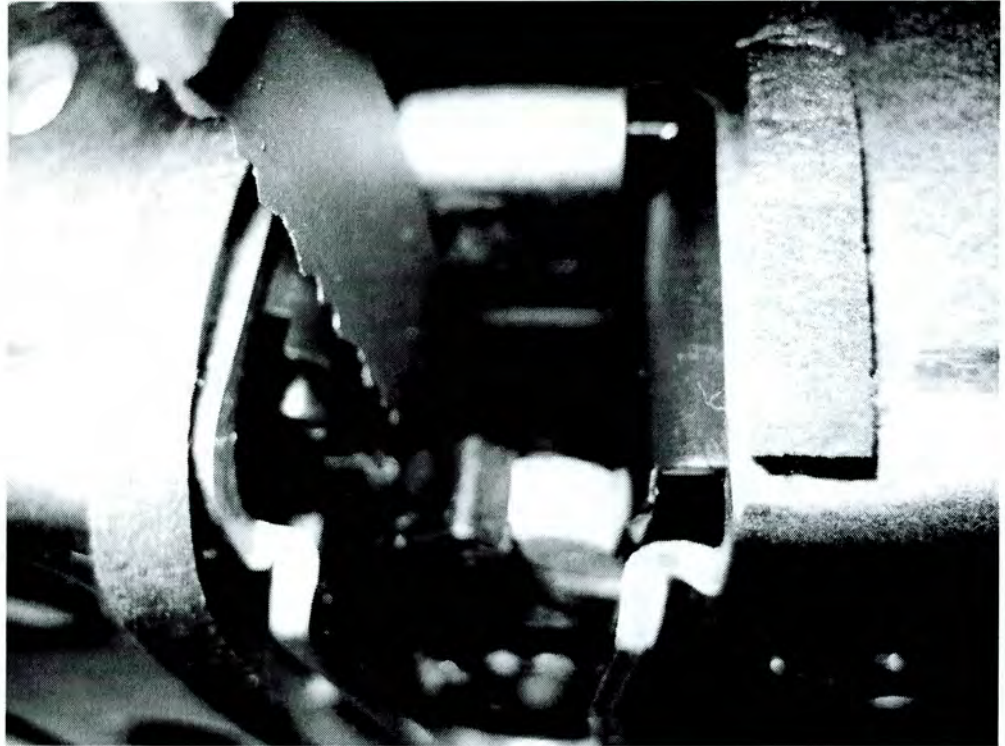


Bild 3.JPG:



Bild 4.JPG:



Bild 5.JPG:

