

STABILIZER BAR BUSHING BRACKET UNDER 24K GVWR

TSB 12-6-1

FORD:
2009 F-53 Motorhome Chassis

2011 F-53 Motorhome Chassis,
F-59 Commercial Stripped Chass

ISSUE

Some 2009 F-53 Motorhome, 2011 F-53 Motorhome and 2011 F-59 Commercial Chassis vehicles under 24K GVWR may exhibit loose or broken bolts at the rear stabilizer bar bushing bracket which may result in a noise from the rear of the chassis.

ACTION

Refer to the Service Procedure to correct the condition.

SERVICE PROCEDURE

Replace the two (2) stabilizer bar bushing brackets with improved parts and the four (4) stabilizer bracket bushing bolts. Refer to the Workshop Manual, 204-02.

PART NUMBER	PART NAME
W500443-S439	Bolt (4 Req)
1C3Z-5486-AA	Stabilizer Bar Bushing Bracket (2 Req)

OPERATION	DESCRIPTION	TIME
120601A	2009 F-53 Motorhome Chassis, 2011 F-53 Motorhome Chassis And F-59 Commercial Stripped Chassis: Replace The Stabilizer Bushing Brackets And The Stabilizer Bracket Bushing Bolts	0.5 Hr.

DEALER CODING

BASIC PART NO.
5486

CONDITION
CODE
24

WARRANTY STATUS: Eligible Under Provisions Of New Vehicle Limited Warranty Coverage
Warranty/ESP coverage limits/policies/prior approvals are not altered by a TSB.
Warranty/ESP coverage limits are determined by the identified causal part and verified using the OASIS part coverage tool.

NOTE: The information in Technical Service Bulletins is intended for use by trained, professional technicians with the knowledge, tools, and equipment to do the job properly and safely. It informs these technicians of conditions that may occur on some vehicles, or provides information that could assist in proper vehicle service. The procedures should not be performed by "do-it-yourselfers". Do not assume that a condition described affects your car or truck. Contact a Ford or Lincoln dealership to determine whether the Bulletin applies to your vehicle. Warranty Policy and Extended Service Plan documentation determine Warranty and/or Extended Service Plan coverage unless stated otherwise in the TSB article. The information in this Technical Service Bulletin (TSB) was current at the time of printing. Ford Motor Company reserves the right to supercede this information with updates. The most recent information is available through Ford Motor Company's on-line technical resources.