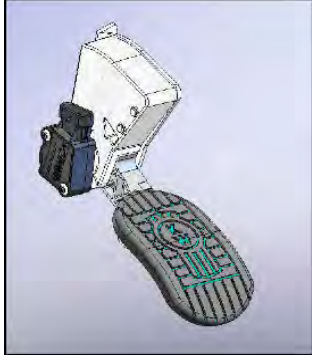


**SB-10045239-3321**

Technical Information Bulletin

44-024

Section

Fuel - 44

Subject

Updated Throttle Pedal for Engine Brake and Throttle Pedal Position Complaints

Release Date

7/18/2012

Revision

07/19/12; The Chassis Affected section was updated to eliminate the variety of model designations previously listed. The intent of this bulletin is to address the combination of Cummins engines and throttle pedal, regardless of Kenworth model.

Condition

Throttle pedal position return range too narrow to engage engine brake; engine brake not engaging

Chassis Affected

Kenworth trucks with 2007-2010 emission compliant Cummins engines.

Action

If a customer comes into your dealership and demonstrates the condition above, inspect the throttle pedal and replace original equipment part number S21-1011 with current production part number S21-1025 as described in the Procedure below.

Warranty

Standard warranty time, mileage and other limitations apply. This bulletin is for repair information only.

For repairs submitted with a warranty claim, parts returns will be required. Following is claim code information for replacement throttle pedal repairs.

CODING

Fail Location: 044-007-047 Failure Type:110 Responsibility: 05 SRT: 044-108
Work Accomplished: 35 Supplier: 05036MA Claim Type: N
Ship Location Code: WL

Williams Controls
Attn: Warranty
14100 SW 72nd Ave
Portland, OR 97224
Collect ship via UPS ground, account 946410

Parts


Parts are available from PACCAR Parts.

<u>Quantity</u>	<u>Part Number</u>	<u>Description</u>
1	S21-1025	throttle pedal assembly

Procedure

1. Verify with the customer or through testing that the failure (Jake inoperative) and cause (throttle pedal position) are consistent with this bulletin Condition and Chassis Affected.
2. Inspect the throttle pedal bracket to identify the installed part number.
3. If part number S21-1011 is installed, replace this with part S21-1025.

Note: Do not replace the sensor only. The sensor is calibrated to the pedal.

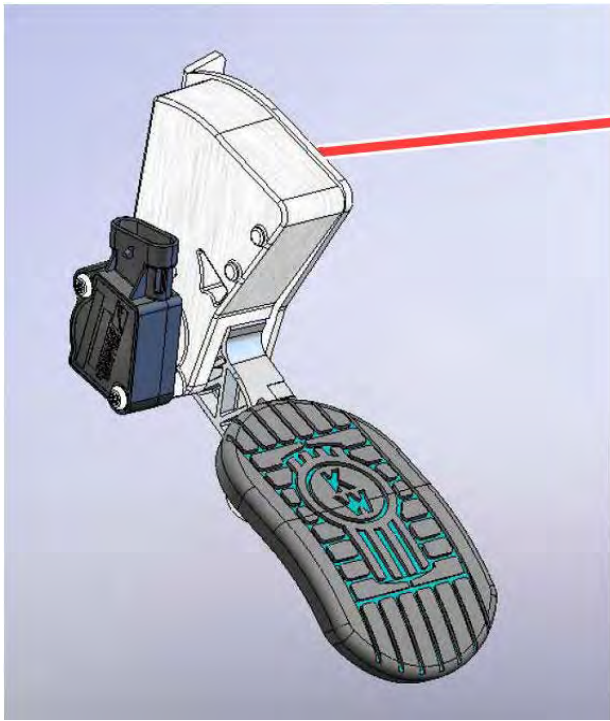

**Replace part S21-1011
with part S21-1025**

Access to PACCAR's Enterprise Portal is provided as a benefit of doing business with PACCAR. All applications and content accessed through this system are confidential and proprietary and the property of PACCAR Inc and its suppliers, and must be kept strictly confidential pursuant to the contract licensing such access. Disclosure, publication, release or distribution of any material found on PACCAR systems to any person other than employees with a need to know such information is strictly prohibited. All activity on this system is monitored. If PACCAR suspects or discovers any unauthorized activity, access may be immediately terminated without prior notification. Violators may be subject to legal action.

© Copyright 2012 PACCAR Inc. All rights reserved. We welcome your [feedback](#) on this page. For technical questions or concerns about this page, please contact the [DealerNet Webmaster](#).