

<p>6.4L—LACK OF POWER—DIAGNOSTIC TROUBLE CODE (DTC) P0088</p>	<p>TSB 12-7-7</p>
--	--------------------------

FORD:
2008-2010 F-Super Duty

This article supersedes TSB 11-4-22 to update the Service Procedure.

ISSUE

Some F-Super Duty 250-550 vehicles equipped with a 6.4L diesel engine may exhibit a lack of power concern with an intermittent DTC P0088; at full operating temperature during moderate to heavy acceleration. A calibration update is available to resolve this concern.

ACTION

Follow the Service Procedure steps to correct the condition.

SERVICE PROCEDURE

Intermittent P0088 diagnostics:

1. Check all continuous memory DTCs. Is DTC P0088 the only code present?
 - a. No - this article does not apply, refer to the Powertrain Control/Emissions Diagnosis (PC/ED) manual to diagnose this concern.
 - b. Yes - continue to Step 2
2. Reprogram the powertrain control module (PCM) to the latest calibration using IDS release 79.05 and higher. This new calibration is not included in the VCM 2012.5 DVD. Calibration files may also be obtained at www.motorcraft.com.

WARRANTY STATUS: Eligible Under Provisions Of New Vehicle Limited Warranty Coverage And Emissions Warranty Coverage. Warranty/ESP coverage limits/policies/prior approvals are not altered by a TSB. Warranty/ESP coverage limits are determined by the identified causal part and verified using the OASIS part coverage tool.

OPERATION	DESCRIPTION	TIME
120707A	2008-2010 F-Super Duty Automatic Transmission: Reprogram The PCM (Do Not Use With Any Other Labor Operations)	0.5 Hr.
120707B	2008-2010 F-Super Duty Manual Transmission: Reprogram The PCM (Do Not Use With Any Other Labor Operations)	0.4 Hr.

DEALER CODING

BASIC PART NO.	CONDITION CODE
9A543	42

NOTE: The information in Technical Service Bulletins is intended for use by trained, professional technicians with the knowledge, tools, and equipment to do the job properly and safely. It informs these technicians of conditions that may occur on some vehicles, or provides information that could assist in proper vehicle service. The procedures should not be performed by "do-it-yourselfers". Do not assume that a condition described affects your car or truck. Contact a Ford or Lincoln dealership to determine whether the Bulletin applies to your vehicle. Warranty Policy and Extended Service Plan documentation determine Warranty and/or Extended Service Plan coverage unless stated otherwise in the TSB article. The information in this Technical Service Bulletin (TSB) was current at the time of printing. Ford Motor Company reserves the right to supercede this information with updates. The most recent information is available through Ford Motor Company's on-line technical resources.