



TECHNICAL BULLETIN

UPS0512-4bNAS1

05 APR 2012

THIS TECHNICAL BULLETIN SUPERSEDES SERVICE ADMINISTRATION BULLETIN 6-179NAS
THIS UPDATE PRIOR TO SALE IS VALID FOR A LIMITED TIME ONLY
AND WILL EXPIRE ON 02 NOVEMBER 2012

SECTION: 417**Update Prior to Sale: Right-Hand Rear Fog Lamp****AFFECTED VEHICLE RANGE:****XK (X150)****VIN: Specific vehicles; see attached list
Model Year: 2012****CONDITION SUMMARY:**

Situation: A limited number of 2012 model year Jaguar XK vehicles may have been manufactured away from process and in some cases the right-hand (RH) rear fog lamp may be incorrectly welded.

Action: Dealers are required to 'HOLD' the affected vehicles within your control and refrain from releasing the vehicles for new or used vehicle sale pending completion of the rework action detailed in this Technical Bulletin. For vehicles in dealer inventory, this UPS should be performed in conjunction with the vehicle Pre-Delivery Inspection (PDI). For vehicles in dealer inventory which have already had the PDI completed, this UPS should be completed prior to final preparation / customer handover. For those vehicles already in the hands of customers, this should be done at the next available opportunity prior to the expiration date.

PARTS:

PART NO.	DESCRIPTION	QTY	% OF VEHICLES REQUIRING PART*
C2P21456	Foam seal	1	100
C2P21458	Rear fog lamp (right-hand)	1	100

TOOLS:

Refer to Workshop Manual for any required special tools

WARRANTY:

△ NOTE: Repair procedures are under constant review, and therefore times / prices are subject to change; those quoted here must be taken as guidance only. Always refer to DDW to obtain the latest repair time. Check DDW to ensure that the vehicle is affected by this Update Prior to Sale Notice prior to undertaking any rework action. At the time of confirming a booking for vehicle repair, ensure that all outstanding Service Actions are identified to ensure the correct parts are available and adequate workshop time is allocated for repairs to be completed at one visit.

Warranty claims must be submitted quoting Program Code 'K128' together with the relevant Option Code from the table. SRO and parts information is included for information only. The Option Code(s) that allows for the drive in / drive out allowance can only be claimed if the vehicle is brought back into the workshop for this action alone to be undertaken.

This Update Prior to Sale notice is valid for a limited time only. Warranty claims with a repair date prior to the **02 November 2012** closure date must be submitted for payment within 30 calendar days of completion of the repair.

NOTE: The information in Technical Bulletins is intended for use by trained, professional Technicians with the knowledge, tools, and equipment required to do the job properly and safely. It informs these Technicians of conditions that may occur on some vehicles, or provides information that could assist in proper vehicle service. The procedures should not be performed by 'do-it-yourselfers'. If you are not a Retailer, do not assume that a condition described affects your vehicle. Contact an authorized Jaguar service facility to determine whether this bulletin applies to a specific vehicle.


PROGRAM CODE	OPTION CODE	DESCRIPTION	SRO	TIME (HOURS)	PART NUMBER	QTY.
K128	B	Fit foam seal; replace right-hand rear fog lamp - Coupe	86.94.41	0.50	C2P21456	1
					C2P21458	1
K128	C	Fit foam seal; replace right-hand rear fog lamp - Coupe Drive in / drive out	86.94.41	0.50	C2P21456	1
			10.10.10	0.10	C2P21458	1
K128	B	Fit foam seal; replace right-hand rear fog lamp - Convertible	86.94.41	0.30	C2P21456	1
					C2P21458	1
K128	C	Fit foam seal; replace right-hand rear fog lamp - Convertible Drive in / drive out	86.94.41	0.30	C2P21456	1
			10.10.10	0.10	C2P21458	1
					-	-

Normal Warranty policies and procedures apply

REPAIR PROCEDURE

REPLACE RIGHT-HAND REAR FOG LAMP

1. Convertible only: refer to Workshop Manual section 501-05: *Interior Trim and Ornamentation*, and remove the luggage compartment lid trim panel.
2. Coupe only: refer to Workshop Manual, section 501-05: *Interior Trim and Ornamentation*, and remove the liftgate lower trim panel.
3. Remove the right-hand (RH) reverse / fog lamp:
 - Remove the three (3) plastic nuts.
 - Disconnect the electrical connector.

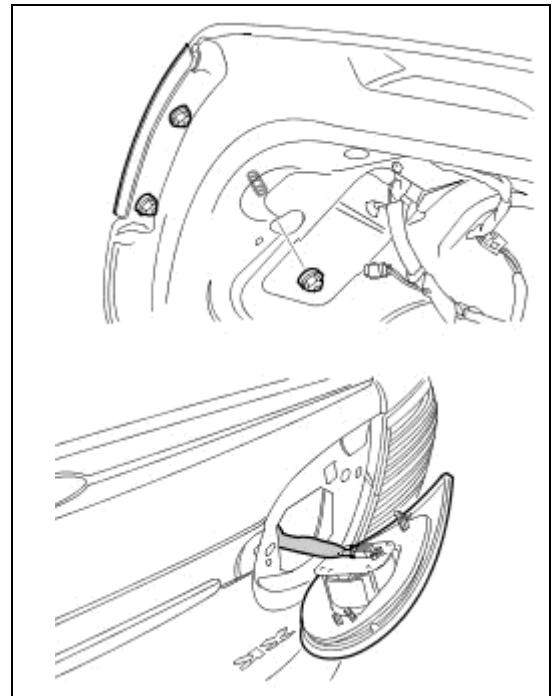

⚠ CAUTION: Clean the contact areas on the lamp making sure all grease and dirt is removed before installing the foam surround.

4. Fit foam seal surround to **new** RH reverse / fog lamp:
 - Starting at the top of the new lamp, peel back the protection and apply foam surround to lamp.
 - Cut off and discard any excess seal.



5. Install the new right-hand (RH) reverse / fog lamp:
 - Connect the electrical connector.
 - Install the three (3) plastic nuts.
6. Convertible only: refer to Workshop Manual section 501-05: *Interior Trim and Ornamentation*, and install the luggage compartment lid trim panel.
7. Coupe only: refer to Workshop Manual, section 501-05: *Interior Trim and Ornamentation*, and install the liftgate lower trim panel.



UPS0512-4bNAS1
Affected VIN List

Canada	
RETAILER CODE / NAME	VIN
3306 John Scotti Jaguar	B47642
4495 Coventry North Jaguar	B47645
4498 Jaguar Thornhill	B47591
6058 Jaguar of Calgary	B47539

USA	
RETAILER CODE / NAME	VIN
0486 Paretto Imports, Inc.	B47647
0518 San Jose British Motors	B47599
0696 Alpine Jaguar	B47644
5386 Jaguar Ventura	B47565
5398 Jaguar Greensboro	B47557
5581 Jaguar Palm Beach	B47636
	B47573
5609 Jaguar Boise	B47533
5612 Jaguar Huntsville	B47537
5670 White Plains Jaguar	B47654
5684 Bergen Jaguar	B47632
5691 Jaguar of Sarasota	B47652
5708 THE COLLECTION	B47541
5727 Crest Jaguar of Woodbridge	B47613
	B47641
5729 Gaudin Jaguar	B47530
	B47611
5744 Jaguar Huntington	B47545
	B47552
5755 Jaguar Anaheim Hills	B47605
5763 Jaguar Ft. Myers	B47551