



Service Bulletin

File in Section: -

Bulletin No.: PI0792

Date: August, 2012

PRELIMINARY INFORMATION

Subject: All Weather Floor Mat Retainer Broken

Models: 2013 Buick Regal
Built Prior to August 1, 2012

Condition/Concern

Some customers may comment on a broken floor mat retainer or the floor mat is difficult to fully seat onto the carpet side retainer.

Recommendation/Instructions

Follow the procedure below for installing the new design floor mat retainer for the right and left front floor mats.

1. Align the upper piece of the mat retainer to the center of the retainer hole. Turn the mat over while maintaining the center position of the retainer.
2. Install the lower piece of the mat retainer onto the mat, aligning it with the upper retainer. Push down hard to engage several retention rings.
3. Using a rubber mallet, lightly tap on the retainer to engage the remaining retention rings.
4. Install the floor mat to the vehicle.

Parts Information

Part Number	Description	Qty.
22867502	Floor Mat Retainer Kit (Black)	2 Per Mat
22867503	Floor Mat Retainer Kit (Cocoa)	2 Per Mat

Warranty Information

For vehicles repaired under warranty, use:

Labor Operation	Description	Labor Time
Z2407*	Floor Mat Retainer Replacement	0.2 hr

*This is a unique labor operation for bulletin use only. It will not be published in the Labor Time Guide.