

# Technical Bulletin

Division: Automotive

Section Title: Body, Cab and Accessories

Category: Technical

TSB No. TS 39 08258

**SUBJECT: TRAILER TURN SIGNAL AND STOP LAMPS INOPERATIVE OR STAY ON AFTER INSTALLING ACCESSORY TRAILER HITCH**

**MODEL(S): XL7 (JC636)**

**YEAR: 2007~**




**CONDITION:** After installing accessory Trailer Hitch 990B0-26005 with Harness Kit 990B0-26006, it may be found that the trailer turn signal and stop lamps are inoperative or stay on at all times.

**CAUSE:** The lamp relays have been installed incorrectly.

**CORRECTION:** Check for proper installation of the "RT TRLR STOP/TRN" and "LT TRLR STOP/TRN" relays. Refer to picture below.

**NOTE: The relay can be installed 4 different ways. Only two of the positions will function correctly. Make sure the relay blades insert into the relay box as shown. The relay will operate properly 180 degrees from the position shown below.**

**The relay will not operate properly if it is inserted 90 degrees from the correct position.**

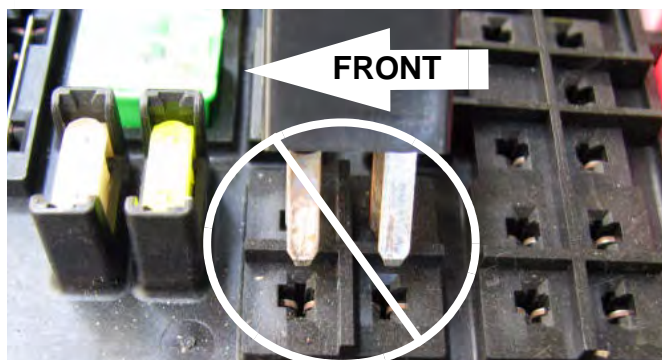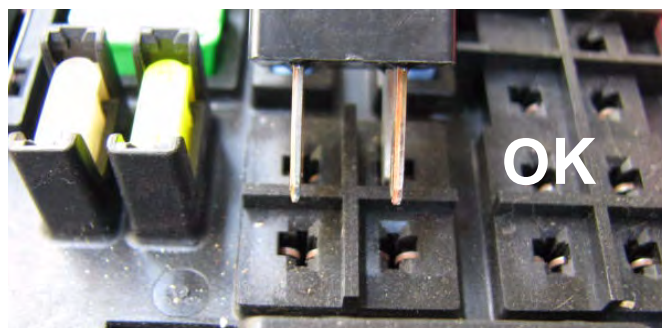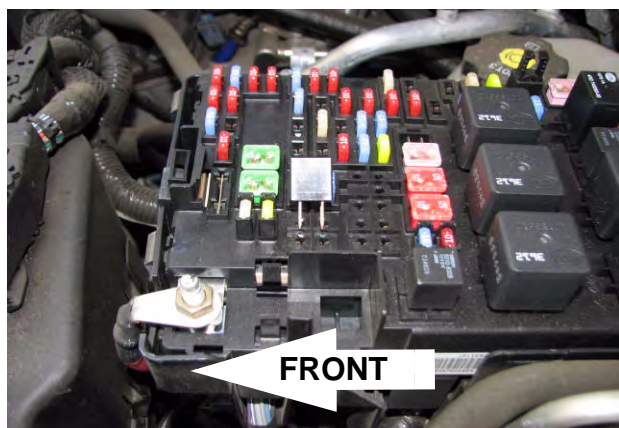

Technical Service Department  
Dealership Circulation - Initial and file:

Service Manager	Parts Manager	Service Advisor	Technicians						

Suzuki bulletins are intended for use by professional technicians, NOT a "do-it-yourselfer." They are written to inform these technicians of conditions that may occur on some vehicles, or to provide information that could assist in the proper service of a vehicle. Properly trained technicians have the equipment, tools, safety instructions, and know-how to do a job properly and safely. If a condition is described, DO NOT assume that the bulletin applies to your vehicle, or that your vehicle will have that condition. See your authorized Suzuki dealer for information on whether your vehicle may benefit from the information. Suzuki reserves the right to change technical specifications at any time without prior notice.