



Technical Service Bulletin

30 Red warning light for brake fluid on with no brake performance concerns - liquid leaks into footwell.

30 12 15 2030732/1 September 27, 2012.

Model(s)	Year	VIN Range	Vehicle-Specific Equipment
B8	2010 – 2013	Not Applicable	0B1 or 0B2 Transmission

Condition

Red warning light "Check brake fluid" appears.

No brake performance concerns.

Liquid leaks into the driver footwell.

Upon inspection technician finds clutch master cylinder leaking.

Technical Background

Debris from the footwell gets between liner and guide bushing and damages clutch master cylinder seal.

New master cylinder has boot to protect from accumulation of debris.

Production Solution

Not applicable.

Service

Replace the clutch master cylinder according to the ElsaWeb Repair Manual with part number **8K1721401G**.

Technical Service Bulletin



Warranty

Claim Type:	Use applicable claim type. If vehicle is outside any warranty, this Technical Service Bulletin is informational only.		
Service Number:	3020		
Damage Code:	0050		
Labor Operations:	Clutch master cylinder remove and reinstall	3020 1900	290 TU
	Clutch system bleed	3001 0750	30 TU
Diagnostic Time:	GFF	No allowance	0 TU
	Road test prior to service procedure	No allowance	0 TU
	Road test after service procedure	0121 0004	10 TU
	Technical diagnosis at dealer's discretion (Refer to Section 2.2.1.2 and Audi Warranty Online for DADP allowance details)		
Claim Comment:	As per TSB #2030732/1		

All warranty claims submitted for payment must be in accordance with the *Audi Warranty Policies and Procedures Manual*. Claims are subject to review or audit by Audi Warranty.

Required Parts and Tools

Part Number	Part Description	Quantity
8K1721401G	Clutch master cylinder	1

Additional Information

All parts and service references provided in this TSB are subject to change and/or removal. Always check with your Parts Department and service manuals for the latest information.