



# Service Bulletin

File in Section: -

Bulletin No.: PIC5751A

Date: October, 2012

## PRELIMINARY INFORMATION

**Subject:** Service Park Brake Message C0558

**Models:** 2013 Chevrolet Malibu

**This PI was superseded to add warranty information. Please discard PIC5751.**

The following diagnosis might be helpful if the vehicle exhibits the symptom(s) described in this PI.

### Condition/Concern

A customer or technician may indicate there is a Service Park Brake Message displayed. The technician may indicate the following DTC's are set C0558 sym5A and/or C0558 sym55. The park brake may not release or cannot perform park brake calibration in GDS2.

### Recommendation/Instructions

Please check that G401 is secure and there is no paint or tape affecting contact. See picture below left rear wheel house.



2915786

### Warranty Information

For wiring repairs covered under warranty, please refer to latest version of bulletin 10-00-89-005 for warranty information on wire/connector repairs.

Please follow this diagnostic or repair process thoroughly and complete each step. If the condition exhibited is resolved without completing every step, the remaining steps do not need to be performed.