



SB-0030 Disc Brake Pad Wear Warning Indicator

Bulletin Number:	SB-0024	Revision:	NR	EIC Number:	N/A	Std. Repair Time:	N/A
Application:	Orion VII EPA10 with disc brake system						
<u>Classification:</u>							
Information Letter	☒	Parts Bulletin	☐	Recall Letter	☐		
Service Manual Update	☐	Operator's Manual Update	☐				

NOTE: For more information, please contact the Orion Service Line at 1-800-71-ORION (1-800-716-7466).

1.0 INTRODUCTION

This Service Information Letter is to inform about the disc brake pad wear warning indicator light on buses equipped with disc brakes.

The pad wear warning indicator (PWWI) system wiring is installed on all buses equipped with disc brakes. Some buses do not yet have the correct PWWI module and instead are equipped with a jumper.

The current PWWI wiring receives power from an ignition signal as opposed to being constantly powered while the bus is awake. When the ignition is turned off, the installed jumper cannot provide power to the PWWI inputs resulting in the activation of the pad wear warning indicator lights. A wiring update will be needed when the PWWI module is installed.