

FLA COE
FLB COE
FLD Conventional
Business Class
FLC 112 Conventional

Century Class Conventional
Argosy COE
Cargo
Columbia

Coronado
Business Class M2
> Cascadia
108SD/114SD

Freightliner
Service Bulletin

General Information

A design change has been made to the ParkSmart internal controller circuit board to protect against high voltage damage. The new controller is installed in all vehicles manufactured from June 21, 2012.

On March 6, 2012, Bergstrom started using round post terminals on all ParkSmart compressors.

If the ParkSmart unit part number is A22-69027-000 and it was built before March 6, 2012, a new controller-to-compressor harness is required to adapt to the spade-type compressor terminals. See [Table 1](#) for the required parts for different controller and harness configurations.

Controller and Harness Replacement

1. Determine the type of controller and harness needed.
2. If a replacement harness is required, replace it as follows.

NOTICE

Do not allow the wires or terminals to turn while tightening the nuts. Doing so will damage the circuit board.

- 2.1 Connect the three phase-wires to the new circuit board terminals as shown in [Fig. 1](#). Install the blue wire on the left terminal, the orange wire on the middle terminal, and the yellow wire on the right terminal. Tighten the nuts 10 lbf-in (113 N-cm).

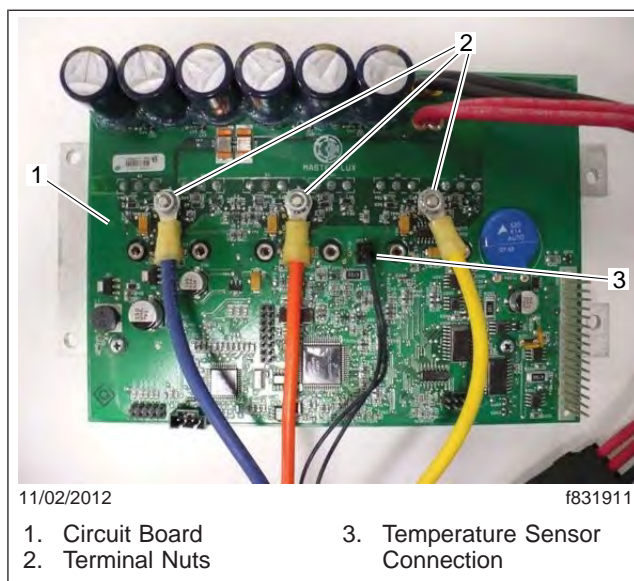


Fig. 1, Circuit Board Wiring

- 2.2 Connect the temperature sensor wire connector to the circuit board.
3. Replace the controller. Follow the instructions in [83.03, Subject 160](#) of the *Cascadia Workshop Manual*.

Freightliner Service Bulletin

FLA COE
FLB COE
FLD Conventional
Business Class
FLC 112 Conventional

Century Class Conventional
Argosy COE
Cargo
Columbia

Coronado
Business Class M2
> Cascadia
108SD/114SD

Parts

Parts are available through the PDC.

Refer to [Table 1](#) for required parts by application.

NOTE: If the ParkSmart unit was previously repaired with a refrigerant loop service kit or an entire unit, the compressor may already have round post-type terminals and the corresponding compressor harness (BSM 1000338843). If so, no harness replacement is needed.

| Controller Replacement, Required Parts | | | |
|--|------------------------|------------------------|--------------------------------|
| Unit Part Number | Manufacture Date | Replacement Controller | Harness |
| A22-69027-002 | All | BSM 1000385968 | Use original. (BSM 1000338843) |
| A22-69027-001 | All | | |
| A22-69027-000 | March 6, 2012 or later | | BSM 1000341665 |
| A22-69027-000 | Before March 6, 2012 | | |

Table 1, Controller Replacement, Required Parts

Warranty

This bulletin is informational only. Warranty does not apply.