



Technical Bulletin

Model(s)	Year	Eng. Code	Trans. Code	VIN Range From	VIN Range To
Jetta	2011-2013	2.5L (CBTA, CBUA)	5spd Manual / MQ250 6spd Automatic / AQ250	AJ_BM300230	AJ_DM366492
Jetta SportWagen, Golf Wagon	2011-2013	2.5L (CBTA, CBUA)	5spd Manual / MQ250 6spd Automatic / AQ250	AJ_BM600203	AJ_DM622987
Golf	2011-2013	2.5L (CBTA, CBUA)	5spd Manual / MQ250 6spd Automatic / AQ250	AJ_BW000445	AJ_DW999999
Passat	2012-2013	2.5L (CBTA, CBUA)	5spd Manual / MQ250 6spd Automatic / AQ250	A3_CC000001	A3_DC025225
Beetle, Beetle Convertible	2012-2013	2.5L (CBTA, CBUA)	5spd Manual / MQ250 6spd Automatic / AQ250	AT_CM601051	AT_DM620428

Condition

17 12 06 December 20, 2012 2032198

Possible Oil Leak from Oil Filter Housing

Manufacturing debris found in the oil filter housing may prevent a proper seal with the filter flange, resulting in an oil leak. This debris must be removed in order to provide a proper seal and prevent leaks. This condition may be more evident after an oil service has been performed.

Technical Background

Plastic manufacturing burrs and debris may build up in the seal area of the oil filter housing. This may prevent a proper seal when installed and result in an oil leak.

Technical Bulletin

Production Solution

New tooling was implemented to prevent debris.

Service



- Clean debris from oil filter housing and reinstall.



Technical Bulletin

Warranty

To determine if this procedure is covered under Warranty, always refer to the Warranty Policies and Procedures Manual ¹⁾					
Model(s)	Year(s)	Eng. Code(s)	Trans. Code(s)	VIN Range From	VIN Range To
Jetta	2011-2013	2.5L CBTA, CBUA	5 spd Manual / MQ250 6 spd Automatic / AQ250	AJ_BM300230	AJ_DM366492
Jetta SportWagen, Golf Wagon	2011-2013	2.5L CBTA, CBUA	5 spd Manual / MQ250 6 spd Automatic / AQ250	AJ_BM600203	AJ_DM622987
Golf	2011-2013	2.5L CBTA, CBUA	5 spd Manual / MQ250 6 spd Automatic / AQ250	AJ_BW000445	AJ_DW999999
Passat	2012-2013	2.5L CBTA, CBUA	5 spd Manual / MQ250 6 spd Automatic / AQ250	A3_CC001988	A3_DC025225
Beetle, Beetle Convertible	2012-2013	2.5L CBTA, CBUA	5 spd Manual / MQ250 6 spd Automatic / AQ250	AT_CM601051	AT_DM620428
SAGA Coding					
Claim Type:			Use applicable Claim Type ¹⁾		
Service Number:	Damage Code	HST	Damage Location (Depends on Service No.)		
1733	0050	--	Use applicable when indicated in ElsaWeb (L/R)		



Technical Bulletin

Parts Manufacturer	Jetta, Jetta Sportwagen, Golf Wagon, Golf, Passat, Beetle, Beetle Convertible	MHO ²⁾
Labor Operation ³⁾ : Remove and Install Noise Dampening Pan	10821900 = 30 TU	
Labor Operation ³⁾ : Remove and Install Oil Filter	17305567 = 20 TU	
Causal Part: Select Labor Operation	17305567	
Diagnostic Time ⁴⁾		
GFF Time expenditure	01500000 = 00 TU max.	NO
Road Test	01210002 = 10 TU 01210004 = 10 TU	NO
Technical Diagnosis	01320000 = 10 TU max.	YES
Claim Comment: Input "As per Technical Bulletin 2032198" in comment section of Warranty Claim.		
¹⁾ Vehicle may be outside any Warranty in which case this Technical Bulletin is informational only ²⁾ Code per warranty vendor code policy. ³⁾ Labor Time Units (TUs) are subject to change with ELSA updates. ⁴⁾ Documentation required per Warranty Policy Procedures Manual.		

Required Parts and Tools

No Special Parts required.

No Special Tools required.

Additional Information

All part and service references provided in this Technical Bulletin are subject to change and/or removal. Always check with your Parts Dept. and Repair Manuals for the latest information.