



**IMPORTANT SERVICE
INFORMATION FOR:**

- ✓ SERVICE MANAGER
- ✓ SERVICE ADVISOR
- ✓ TECHNICIAN
- ✓ PARTS DEPARTMENT
- ✓ WARRANTY PERSONNEL

BULLETIN NUMBER:
IB12-L-002

ISSUE DATE:
DECEMBER 2012

GROUP:
FUEL & EXHAUST

HISTORY DTCs P203D & P205D – DIAGNOSTIC ASSISTANCE

AFFECTED VEHICLES

- 2011-2013MY Isuzu N-Series
Equipped with Selective Catalyst Reduction (SCR)

INFORMATION

Some customers may experience reduced power condition associated with an illuminated check engine light as well as a low Diesel Exhaust Fluid (DEF) light.

Technician diagnosis may identify DTCs P203D and/or P205D stored as history codes in the DEF control module.

If either of these DTCs are found as history codes, check the harness connectors (J-167, J-143, H-171) for poor connection, damage or corrosion. After inspection and any adjustments, clear the DTCs and attempt to reset the code. If the code does not reset, it may have been an intermittent condition caused by a loose or incorrect electrical connection. Do not replace any parts if the code cannot be duplicated.

NOTE: If the subject codes are active, refer to the service manual diagnostic.