



File in Section: -

Bulletin No.: PI0093A

Date: December, 2012

Service Bulletin

PRELIMINARY INFORMATION

Subject: Intermittent Click/Clunk Type Noise from Steering Column Area During Turns

Models: 2009-2012 Chevrolet Colorado
2009-2012 GMC Canyon

This PI is being revised to add model years. Please discard PI0093.

Condition/Concern


Some customers may comment on a click or clunk type noise from the steering column only when turning the steering wheel. They also may feel a slight pop from steering wheel or steering column housing.



2443279

The cause of this condition may be due to the toe plate stud orientation being at the bottom of the slot (1).

Recommendation/Instructions

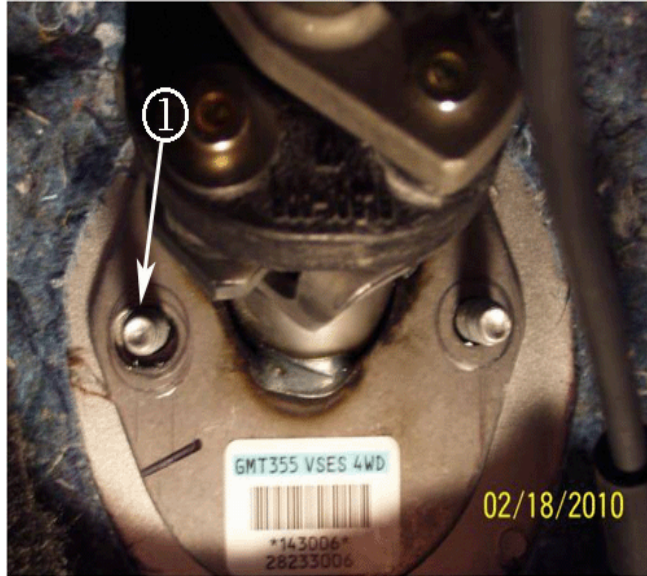

2427856

Remove the cowl stud fastener nuts located under the driver's dashboard by the pedals. Slightly shift the plate downward on the left side, causing the left stud to be at the top of the enlarged hole (1) as shown above. Reinstall the nuts and tighten to specification.

Warranty Information

For vehicles repaired under warranty, use:

Labor Operation	Description	Labor Time
E9517*	Rotate Steering Column Plate	0.3 hr
*This is a unique labor operation for bulletin use only. It will not be published in the Labor Time Guide.		