



TECHNICAL SERVICE BULLETIN

TSB#: 12-007

Job Code: 9801148

Flat Rate: 0.5 hr

NOTE: This Technical Service Bulletin will be valid within (1) year from the original date of publication.
REQUIRES PARTS TO BE ORDERED FROM Jayco for every unit.

ACTION REQUIRED:

Replace the gas line main quick disconnect valve and test.

MODELS / UNITS:

2013 Jay Flight Bungalow Travel Trailers

40 BHS D11A0113-0115, 0118

40 FER D11C0108, 0112

40 FKS D11D0121-0122, 0125

2013 Jay Flight Travel Trailers

26 RLS D18N0172, 0179, 0181, 0183, 0187

29 RLDS D18U0169

2013 Eagle Travel Trailers

328 RLTS D1DS0238, 0243

2013 Jay Feather Ultra Lite Travel Trailer

16V D1JV0099, 0103

2013 Jay Feather Ultra Lite EXP Travel Trailer

X17Z D1JZ0370, 0374, 0376, 0378, 0383, 0387, 0392-0393, 0395

X18D D1JD0157

X23B D1JB0249, 0267, 0269, 0277, 0280, 0284, 0298

KIT CONTENTS

12-007

Note: Kit can only be ordered using the order form included with this bulletin.

(1) gas line quick disconnect valve
Instructions

TOOLS/MATERIAL REQ.:

Soapy water. Do not use products that contain ammonia or chlorine.

Appliance gas tester

Phillips screwdriver


5/8" open end wrench

3/4" open end wrench

7/8" open end wrench

INSTRUCTIONS


1. Close all tank valves. Make sure the quick disconnect valve is in the closed position.
2. Locate the main gas line connection. It will be located at the rear door (curb) side of the unit, behind the bottom skirt. The fitting to be replaced is the main gas line quick disconnect valve. Loosen (using 2 open 5/8" & 3/4" wrenches) the quick disconnect valve.

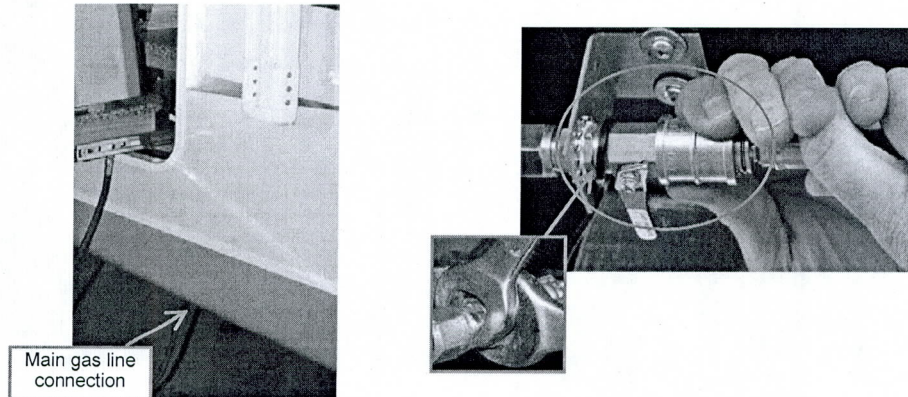


3. Install the new quick disconnect valve. Tighten the valve on the main gas line using the two wrench method. Make sure the connection is tight.

Set up for testing


4. Close all tank valves
5. Using a 7/8" wrench, loosen and disconnect the unit gas hose from the gas regulator.
NOTE: When disconnecting the hose from the regulator, a wrench should be used to hold the regulator fitting in place. Failure to do so may cause the fitting to loosen in the regulator resulting in a gas leak.

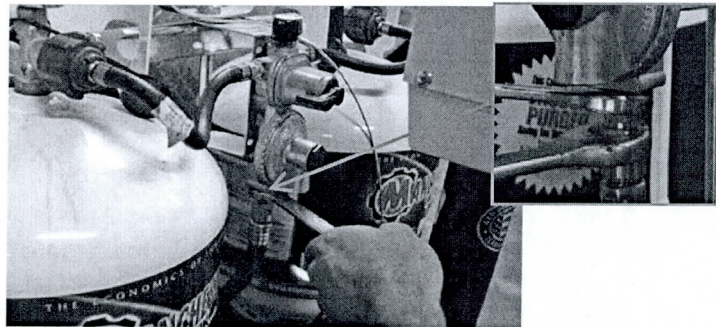

6. Hook up the unit gas hose to the appliance tester. Make sure the connection is tight.

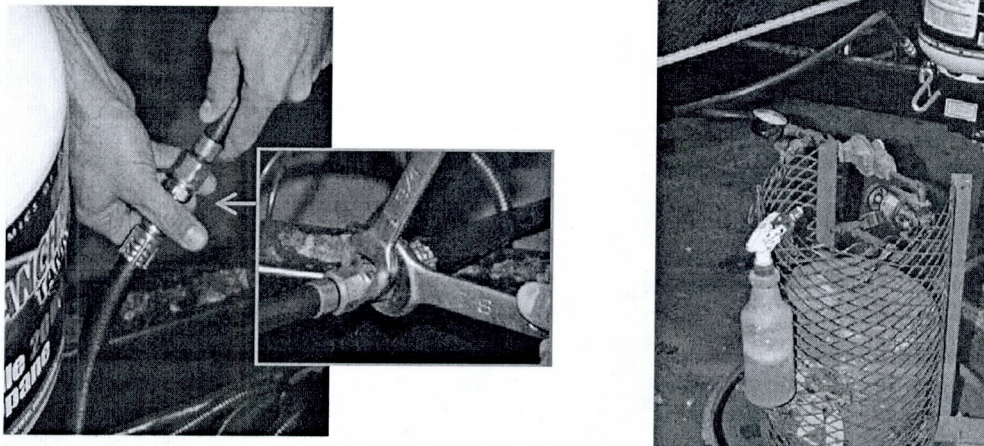

7. Open the valve on the appliance tester until the pressure is **NO LESS THAN 10 AND NO MORE THAN 14 INCHES OF WATER COLUMN.**
8. Close the tester valve. Observe the tester gauge to assure the pressures holds for a **MINIMUM OF 3 MINUTES.**

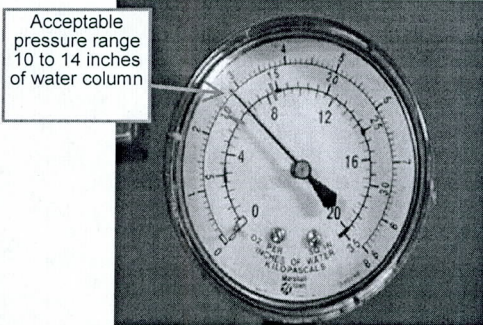

9. Use soap and water to spray the gas connections at the new quick disconnect valve. **NOTE: Do not use products that contain ammonia or chlorine.** Watch for bubbles at the connections for a **MINIMUM OF 3 MINUTES.**
 - If there are no bubbles present **AND** there is no drop in the pressure on the gauge, the connections pass the inspection. Proceed with the next step.
 - If there are no bubbles but the gauge **DID NOT** hold pressure, the leak needs to be identified and the quick disconnect valve connection re-tested.
 - If there **ARE BUBBLES** at the connection indicating a leak, tighten all of the connections. Once the connections have been tightened, **RE-TEST FOLLOWING THE PROCEDURE OUTLINED BEGINNING AT STEP 7.**
10. Disconnect the tester and re-connect the unit hose to the regulator.

NOTE: If the LP tanks are full, pressure test has passed, and all connections are complete, soap test the regulator connection (see Step #5) by opening one of the LP tanks and watching for soap bubbles. If needed, tighten the connection and re-soap until bubbles are eliminated.

Jayco Service / Parts
 Technical Bulletin Order Form
 Fax (800) 825-8409



Jay Flight; Jay Feather; Eagle
 Replace Disconnect Valve
 12-007

Technical Publication Expires: October, 2013

Dealer Name: _____

Acct.#: TB95 _____ Date: _____

Dealer Account Number: _____

Phone: _____ Fax: _____

Ship To: _____

P.O.# _____

Attn: _____

Ship Via: _____

Each unit serial number MUST be recorded when ordering.

Quantity Ordered	Serial Number of Unit (Last 8 Digits)	Part Number	U/M	Unit Price
	<input type="text"/>	12-007 12-007,A 9801148 VALVE-Q.DISCT	EA	N/C
	<input type="text"/>	12-007 12-007,A 9801148 VALVE-Q.DISCT	EA	N/C
	<input type="text"/>	12-007 12-007,A 9801148 VALVE-Q.DISCT	EA	N/C
	<input type="text"/>	12-007 12-007,A 9801148 VALVE-Q.DISCT	EA	N/C
	<input type="text"/>	12-007 12-007,A 9801148 VALVE-Q.DISCT	EA	N/C
	<input type="text"/>	12-007 12-007,A 9801148 VALVE-Q.DISCT	EA	N/C
	<input type="text"/>	12-007 12-007,A 9801148 VALVE-Q.DISCT	EA	N/C
	<input type="text"/>	12-007 12-007,A 9801148 VALVE-Q.DISCT	EA	N/C
	<input type="text"/>	12-007 12-007,A 9801148 VALVE-Q.DISCT	EA	N/C

**THESE PARTS CAN ONLY BE ORDERED USING THIS FORM.
 YOU CAN NOT PLACE THE ORDER THROUGH TRADEROUTE.**



903 South Main Street • P.O. Box 460 • Middlebury, IN 46540 • (574) 825-0608 • Fax (574) 825-0572

October 2012

Technical Service Bulletin Notification TSB#12-007

Dear Jayco Dealer:

Jayco has determined that on certain model year 2013 Eagle Travel Trailers, Jay Flight Travel Trailers, Jay Flight Bungalows, and Jay Feather Ultra Lite Travel Trailers the exterior grill coupler may not make a proper connection to the fitting for the exterior grill LP line. As a result, the grill will not be able to operate since LP will not flow from the coupler when the valve is opened. To prevent this occurrence, it is necessary to replace the coupler even if the unit was not built with the option for the grill. The coupler is standard equipment.

The coverage period for this Technical Service Bulletin is for one (1) year from the release of this notification. If you have any questions on this Bulletin, please contact our Customer Service department at 800-283-8267. A copy of the bulletin is attached.

We apologize for this inconvenience. However, we are confident that this improvement will offer continued satisfaction with Jayco brand products.

Sincerely,

Jayco, Inc.



903 South Main Street • P.O. Box 460 • Middlebury, IN 46540 • (574) 825-0608 • Fax (574) 825-0572

October 2012

SERIAL#
FIRST LAST_NAME
ADDRESS
CITY, STATE ZIP
COUNTRY

Technical Service Bulletin Notification TSB #12-007

Dear Jayco Owner:

Jayco has determined that on certain model year 2013 Eagle Travel Trailers, Jay Flight Travel Trailers, Jay Flight Bungalows, and Jay Feather Ultra Lite Travel Trailers the exterior grill coupler may not make a proper connection to the fitting for the exterior grill LP line. As a result, the grill will not be able to operate since LP will not flow from the coupler when the valve is opened. To prevent this occurrence, it is necessary to replace the coupler even if the unit was not built with the option for the grill. The coupler is standard equipment.

Our records indicate that your Recreational Vehicle is affected. Please contact your nearest Jayco dealer to schedule an appointment. Present this letter as authorization to have the procedure completed at no cost to you.

The coverage period for this Technical Service Bulletin is for one (1) year from the release of this notification. If you have sold or traded your vehicle, or for any reason cannot have this service performed, please contact our customer service department at 800-283-8267.

We apologize for this inconvenience. However, we are confident that this improvement will offer continued satisfaction with your Jayco Recreational Vehicle.

Sincerely,

Jayco, Inc.