

<p>6.7L—MALFUNCTION INDICATOR LAMP (MIL) ON DIAGNOSTIC TROUBLE CODES (DTCS) P2031, P2032 AND/OR P2033</p>	<p>TSB 12-7-2</p>
--	--------------------------

FORD:

2011-2012 F-Super Duty

ISSUE

Some 2011-2012 F-Super Duty vehicles equipped with a 6.7L diesel engine may experience a MIL on concern with any or all of the following DTCs P2031, P2032 and/or P2033.

ACTION

Follow service procedure to correct condition.

SERVICE PROCEDURE

1. Using the Ford Integrated Diagnostic System (IDS) service tool or equivalent scan tool, check all continuous memory diagnostic trouble codes (CMDTCS). Are any or all of the following DTCs present? P2031, P2032, P2033?
 - a. No - this article does not apply, refer to the Powertrain Control/Emissions Diagnosis (PC/ED) manual to diagnose the concern.
 - b. Yes - replace the exhaust gas temperature (EGT12) sensor. This is the second sensor downstream of the turbo charger. Refer to Workshop Manual, Section 303-14B the exploded view.

WARRANTY STATUS: Eligible Under Provisions Of New Vehicle Limited Warranty Coverage And Emissions Warranty Coverage
 Warranty/ESP coverage limits/policies/prior approvals are not altered by a TSB.
 Warranty/ESP coverage limits are determined by the identified causal part and verified using the OASIS part coverage tool.

OPERATION	DESCRIPTION	TIME
120702A	2011-2012 F-Super Duty 6.7L: Check DTCs, And Replace One (1) EGT Sensor (Do Not Use With Any Other Labor Operations)	0.5 Hr.

DEALER CODING

BASIC PART NO.
5J213

CONDITION CODE
42

PART NUMBER	PART NAME
AC3Z-5J213-A	EGT12 Sensor

NOTE: The information in Technical Service Bulletins is intended for use by trained, professional technicians with the knowledge, tools, and equipment to do the job properly and safely. It informs these technicians of conditions that may occur on some vehicles, or provides information that could assist in proper vehicle service. The procedures should not be performed by "do-it-yourselfers". Do not assume that a condition described affects your car or truck. Contact a Ford or Lincoln dealership to determine whether the Bulletin applies to your vehicle. Warranty Policy and Extended Service Plan documentation determine Warranty and/or Extended Service Plan coverage unless stated otherwise in the TSB article. The information in this Technical Service Bulletin (TSB) was current at the time of printing. Ford Motor Company reserves the right to supercede this information with updates. The most recent information is available through Ford Motor Company's on-line technical resources.