

**HYUNDAI**NEW THINKING.
NEW POSSIBILITIES.**Technical Service Bulletin**

GROUP	NUMBER
EMISSION CONTROL	12-EC-001
DATE	MODEL
OCTOBER 2012	ELANTRA (MD)

SUBJECT: FRONT MUFFLER RATTLE NOISE IN REVERSE WHEN COLD*This TSB supersedes TSB 12-AT-003 to revise the Service Procedure*

Description: Some Elantra (MD) vehicles may experience a rattle noise from the front muffler when stopped or backing up. The noise is most noticeable when the engine is cold and does not occur after the engine is warm.

This Service Bulletin provides a procedure to replace the front muffler hanger.

*** NOTE**

Refer to TSB 12-EM-001-2 if the rattle noise is from the center muffler heat shield underneath the vehicle when the engine is cold or hot.

Applicable Vehicles: Elantra(MD) with automatic transaxle (VINs beginning with KMHDH-)
Applicable Production Date Range: From the beginning of production to Nov. 23, 2011

PARTS INFORMATION:

PART NAME	PREVIOUS PART NUMBER	NEW PART NUMBER
Front Muffler Hanger		
	28760-2G000	28761-H1000-FFF

WARRANTY INFORMATION:


OP CODE	OPERATION	OP TIME	CAUSAL PART	NATURE CODE	CAUSE CODE
28760F00	Front muffler hanger	0.2	28760-2G000	N29	C10

**WARNING**

Allow the muffler to cool before beginning the repair.


SERVICE PROCEDURE:

1. Lift up the vehicle on a hoist and locate the front hanger of the front muffler (A).

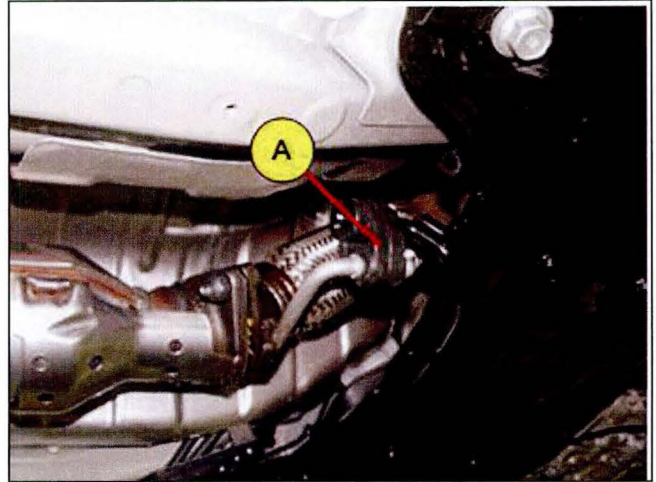

2. Remove the front hanger of the front muffler.

Pull the upper hole side of the front hanger off the nipple (black), then remove the hanger.

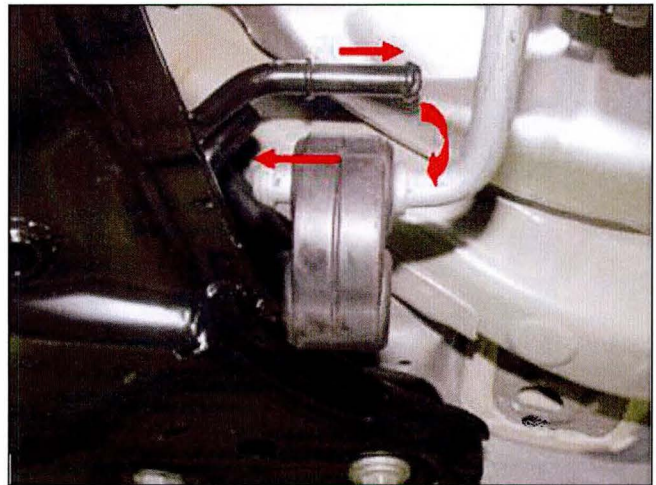

3. Install the new front hanger in reverse order of removal.



4. Test the vehicle to confirm the rattle noise is eliminated.

*** NOTE**

If a rattle noise is heard from the center muffler heat shield underneath the vehicle when the engine is cold or hot, refer to TSB 12-EM-001-2 for the repair procedure.