T-SB-0230-12

Rev1

November 27, 2012



Air Injection System MIL "ON"

Service

Category Engine/Hybrid System

Section

Engine Control

Market USA



Applicability

YEAR(S)	MODEL(S)	ADDITIONAL INFORMATION
2005 – 2009	4Runner	VDS(s): BT14R, BT17R, ZT14R, ZT17R
2006 – 2007	Land Cruiser	
2005 – 2007	Sequoia	VDS(s): BT44A, BT48A, ZT34A, ZT38A
2005 – 2006	Tundra	VDS(s): BT441, BT481, DT441, DT481, ET341, ET381, JT321, KT421, RT341, RT381

REVISION NOTICE

October 17, 2013 Rev1:

- The entire bulletin has been updated to include DTC P2445 and diagnosis of the Air Injection Control Driver.
- Applicability has been updated to include 2006 2007 model year Land Cruiser vehicles.
- · Parts Information has been updated.

Any previous printed versions of this bulletin should be discarded.

SUPERSESSION NOTICE

The information contained in this bulletin supersedes SB No. EG027-07.

Information from EG027-07 has been combined with T-SB-0230-12.

Service Bulletin No. EG027-07 is Obsolete and any printed versions should be discarded. Be sure to review the entire content of this bulletin before proceeding.

T-SB-0230-12

Introduction

Some 2005 – 2009 model year 4Runner, 2006 – 2007 model year Land Cruiser, 2005 – 2007 model year Sequoia, and 2005 – 2006 model year Tundra vehicles equipped with the 2UZ-FE (4.7 L) engine may exhibit a MIL "ON" condition for the following Diagnostic Trouble Codes (DTCs):

- P0412 Secondary Air Injection System Switching Valve "A" Circuit
- P0418 Secondary Air Injection System Relay "A" Circuit
- P1440/P1443 Secondary Air Injection System Control Valve Circuit Bank 1 / Bank 2
- P1441/P1444 Secondary Air Injection System Switching Valve No. 2 Bank 1 / Bank 2 Stuck Open
- P2440 Secondary Air Injection System Switching Valve Stuck Open Bank 1
- P1442/P1445 Secondary Air Injection System Switching Valve No. 2 Bank 1 / Bank 2 Stuck Close
- P2441 Secondary Air Injection System Switching Valve Stuck Close Bank 1
- P2445 Secondary Air Injection System Pump Stuck Off Bank 1

This condition may be caused by debris passing through the air injection pump assembly and contaminating various components in the system. Use the following procedure to address this condition.

Parts Information

PART NUMBER			
PREVIOUS	NEW	PART NAME	
17600-0F010		Pump Assembly, Air	
17171	-50030	Gasket, Intake Manifold to Head No. 1	2
25710-50020 25710-50021	25710-50022	Valve Assy, Air Switching	
25720-50010	25720-50011	Valve Assy, Air Switching, No. 1	
25720-50020		Valve Assy, Air Switching, No. 2	
17377	-50010	Gasket, Air Tube	4**
89580-34010 89580-34011 89581-34040 89581-34041 89581-71010		Driver, Air Injection Control	1

^{*} Replace ONLY If damaged by debris. Reuse parts when possible.

^{** 2} per valve.

T-SB-0230-12

Warranty Information

OP CODE	DESCRIPTION	MODEL	TIME	OFP	T1	T2
EG1215	R & R Air Pump Assy	4Runner	1.6	17600-0F010		99
		Land Cruiser	2.2 +0.3 +0.5			
		Sequoia				
		Tundra			8A	
Combo A	R & R Valve Assy, Air Switching*					
Combo B	R & R Valve Assy, Air Switching, No. 1 and/or No. 2*	All				
Combo C	R & R Air Injection Control Driver	All	+0.5	15 10 1		

^{*} Replace ONLY If damaged by debris. Reuse parts when possible.

APPLICABLE WARRANTY

- This repair is covered under the Toyota Basic Warranty. This warranty is in effect for 36 months or 36,000 miles, whichever occurs first, from the vehicle's in-service date.
- For California specification vehicles sold and operated in California, Connecticut (starting with '08 MY), Maine, Massachusetts, New Jersey (starting with '09 MY), Oregon (starting with '09 MY), Pennsylvania (starting with '08 MY), Rhode Island (starting with '08 MY), Vermont, and Washington (starting with '09 MY), this repair is covered under the California Emission Warranty, which is 84 months or 70,000 miles, whichever occurs first, from the vehicle's in-service date.
- Warranty application is limited to occurrence of the specified condition described in this bulletin.

Required Tools & Equipment

REQUIRED EQUIPMENT	SUPPLIER	PART NUMBER	QTY
Techstream 2.0*		TS2UNIT	le Sa, E
TIS Techstream	ADE	TSPKG1	1
Techstream Lite	THEFT LIE	TSLITEDLR01	

^{*} Essential SST.

NOTE

- Only ONE of the Techstream units listed above is required.
- Software version 8.20.019 or later is required.
- Additional Techstream units may be ordered by calling Approved Dealer Equipment (ADE) at 1-800-368-6787.

T-SB-0230-12

Repair Procedure

1. Using Techstream, check if DTCs P0412, P0418, P1440/P1443, P1441/P1444, P1442/P1445, P2440, P2441, or P2445 are present.

If DTC is present, refer to the Technical Information System (TIS), applicable model and model year Repair Manual:

4Runner:

- 2005 4Runner: Engine/Hybrid System – Engine Control – "SFI System (2UZ-FE): P0412 Secondary Air Injection System Switching Valve "A" Circuit"
- 2006 / 2007 / 2008 / 2009 4Runner: Engine/Hybrid System – Engine Control – "2UZ-FE Engine Control System: SFI System: P0412; Secondary Air Injection System Switching Valve "A" Circuit"
- 2005 4Runner: Engine/Hybrid System – Engine Control – "SFI System (2UZ-FE): P0418 Air Injection System Relay "A" Circuit"
- 2006 / 2007 / 2008 / 2009 4Runner: Engine/Hybrid System – Engine Control – "2UZ-FE Engine Control System: SFI System: P0418; Secondary Air Injection System Control "A" Circuit"
- 2005 4Runner: Engine/Hybrid System – Engine Control – "SFI System (2UZ-FE): P1440, P1443 Secondary Air Injection System Control Valve Circuit Bank 2"
- 2006 / 2007 / 2008 / 2009 4Runner:
 Engine/Hybrid System Engine Control "2UZ-FE Engine Control System: SFI System:
 P1440, P1443; Secondary Air Injection Vacuum Switching Valve Circuit Malfunction Bank 1"
- 2005 4Runner: Engine/Hybrid System – Engine Control – "SFI System (2UZ-FE): P1441, P1444, P2440 Secondary Air Injection System Switching Valve Stuck Open Bank 1"
- 2006 / 2007 / 2008 / 2009 4Runner: Engine/Hybrid System – Engine Control – "2UZ-FE Engine Control System: SFI System: P1441, P1444, P2440; Stuck Open in Secondary Air Injection Vacuum Switching Valve Bank 1"
- 2005 4Runner: Engine/Hybrid System – Engine Control – "SFI System (2UZ-FE): P1442, P1445, P2441 Secondary Air Injection System Switching Valve Stuck Open Bank 1"
- 2006 / 2007 / 2008 / 2009 4Runner: Engine/Hybrid System – Engine Control – "2UZ-FE Engine Control System: SFI System: P1442, P1445, P2441; Stuck Close in Secondary Air Injection Vacuum Switching Valve Bank 1"

Repair Procedure (Continued)

- 2005 4Runner: Engine/Hybrid System – Engine Control – "SFI System (2UZ-FE): P2445 Secondary Air Injection System Pump Stuck Off Bank 1"
- 2006 / 2007 / 2008 / 2009 4Runner: Engine/Hybrid System – Engine Control – "2UZ-FE Engine Control System: SFI System: P2445; Secondary Air Injection System Pump Stuck On Bank 1"

Land Cruiser:

- 2006 / 2007 Land Cruiser: Engine/Hybrid System – Engine Control – "2UZ-FE Engine Control System: SFI System: P0412; Secondary Air Injection System Switching Valve "A" Circuit"
- 2006 / 2007 Land Cruiser: Engine/Hybrid System – Engine Control – "2UZ-FE Engine Control System: SFI System: P0418; Secondary Air Injection System Control "A" Circuit"
- 2006 / 2007 Land Cruiser: Engine/Hybrid System – Engine Control – "2UZ-FE Engine Control System: SFI System: P1440, P1443; Secondary Air Injection Vacuum Switching Valve Circuit Malfunction Bank 1"
- 2006 / 2007 Land Cruiser: Engine/Hybrid System – Engine Control – "2UZ-FE Engine Control System: SFI System: P1441, P1444, P2440; Stuck Open in Secondary Air Injection Vacuum Switching Valve Bank 1"
- 2006 / 2007 Land Cruiser:
 Engine/Hybrid System Engine Control "2UZ-FE Engine Control System:
 SFI System: P1442, P1445, P2441; Stuck Close in Secondary Air Injection Vacuum Switching Valve Bank 1"
- 2006 / 2007 Land Cruiser: Engine/Hybrid System – Engine Control – "2UZ-FE Engine Control System: SFI System: P2445; Secondary Air Injection System Pump Stuck On Bank 1"

Sequoia:

- 2005 Sequoia: Engine/Hybrid System – Engine Control – "Engine: P0412 Secondary Air Injection System Air Switching Valve "A" Circuit"
- 2006 / 2007 Sequoia: Engine/Hybrid System – Engine Control – "2UZ-FE Engine Control System: SFI System: P0412; Secondary Air Injection System Switching Valve "A" Circuit"

Repair Procedure (Continued)

CONTACT

- 2005 Sequoia: Engine/Hybrid System – Engine Control – "Engine: P0418 Air Injection System Air Pump Malfunction"
- 2006 / 2007 Sequoia: Engine/Hybrid System – Engine Control – "2UZ-FE Engine Control System: SFI System: P0418; Secondary Air Injection System Control "A" Circuit"
- 2005 Sequoia: Engine/Hybrid System – Engine Control – "Engine: P1440, P1443 Secondary Air Injection System Control Valve Circuit Bank 2"
- 2006 / 2007 Sequoia:
 Engine/Hybrid System Engine Control "2UZ-FE Engine Control System: SFI System:
 P1440, P1443; Secondary Air Injection Vacuum Switching Valve Circuit Malfunction Bank 1"
- 2005 Sequoia: Engine/Hybrid System – Engine Control – "Engine: P1441, P1444, P2440 Secondary Air Injection System Switching Valve Stuck Open Bank 1"
- 2006 / 2007 Sequoia: Engine/Hybrid System – Engine Control – "2UZ-FE Engine Control System: SFI System: P1441, P1444, P2440; Secondary Air Injection Vacuum Switching Valve Circuit Malfunction Bank 1"
- 2005 Sequoia: Engine/Hybrid System – Engine Control – "Engine: P2445 Secondary Air Injection System Pump Stuck On Bank 1"
- 2006 / 2007 Sequoia: Engine/Hybrid System – Engine Control – "2UZ-FE Engine Control System: SFI System: P2445; Secondary Air Injection System Pump Stuck On Bank 1"

Tundra:

- 2005 Tundra: Engine/Hybrid System – Engine Control – "Engine (2UZ-FE): P0412 Secondary Air Injection System Air Switching Valve "A" Circuit"
- 2006 Tundra: Engine/Hybrid System – Engine Control – "2UZ-FE Engine Control System: SFI System: P0412; Secondary Air Injection System Switching Valve "A" Circuit"
- 2005 Tundra: Engine/Hybrid System – Engine Control – "Engine (2UZ-FE): P0418 Air Injection System Air Pump Malfunction"
- 2006 Tundra: Engine/Hybrid System – Engine Control – "2UZ-FE Engine Control System: SFI System: P0418; Secondary Air Injection System Control "A" Circuit"

T-SB-0230-12

Repair Procedure (Continued)

- 2005 Tundra: Engine/Hybrid System – Engine Control – "Engine (2UZ-FE): P1440, P1443 Secondary Air Injection System Control Valve Circuit Bank 2"
- 2006 Tundra: Engine/Hybrid System – Engine Control – "2UZ-FE Engine Control System: SFI System: P1440, P1443; Secondary Air Injection Vacuum Switching Valve Circuit Malfunction Bank 1"
- 2005 Tundra: Engine/Hybrid System – Engine Control – "Engine (2UZ-FE): P1441, P1444, P2440 Secondary Air Injection System Switching Valve No. 2 Stuck Open Bank 1"
- 2006 Tundra: Engine/Hybrid System – Engine Control – "2UZ-FE Engine Control System: SFI System: P1441, P1444, P2440; Secondary Air Injection Vacuum Switching Valve Circuit Malfunction Bank 1"
- 2005 Tundra: Engine/Hybrid System - Engine Control - "Engine (2UZ-FE): P1442, P1445, P2441 Secondary Air Injection System Switching Valve Stuck Close Bank 1"
- 2006 Tundra: Engine/Hybrid System – Engine Control – "2UZ-FE Engine Control System: SFI System: P1442, P1445, P2441; Stuck Close in Secondary Air Injection Vacuum Switching Valve Bank 1"
- 2005 Tundra: Engine/Hybrid System – Engine Control – "Engine (2UZ-FE): P2445 Secondary Air Injection System Pump Stuck Off Bank 1"
- 2006 Tundra: Engine/Hybrid System – Engine Control – "2UZ-FE Engine Control System: SFI System: P2445 Secondary Air Injection System Pump Stuck On Bank 1"
- 2. After repair, if any DTCs are displayed at this time, clear the DTC(s) and click Data List.
- 3. Select All Data.
- 4. Display the following parameters:
 - Secondary Air Control VSV
 - 2nd Air System Status
 - MIL

Repair Procedure (Continued)

- Start the engine and wait for air pump operation.
 - Secondary Air Control VSV = ON
 - 2nd Air System Status = ON

T-SB-0230-12


NOTE

If Secondary Air Control VSV and 2nd Air System Status do not change to "ON," perform again after engine cools.

November 27, 2012

- If MIL illuminates, or a DTC is detected, proceed to step 6.
- If MIL does not illuminate, or a DTC is not detected, proceed to step 8.
- 6. Using Techstream, check for DTCs. If P0418 and/or P2445 are present, replace the Air Injection Control Driver.

Figure 1.

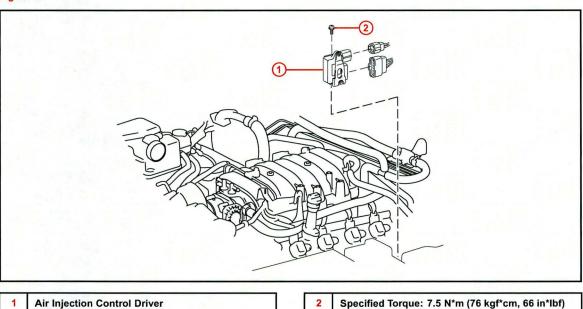

- 7. If physical inspection is required through the Repair Manual diagnostic process, look for debris that may have contaminated the air injection system. The debris may consist of air injection pump filter material or fan blade fragments.
- 8. If such debris is found, replace the air injection pump. If not, go to step 10.
- 9. Additionally, determine if the debris can be removed from any secondarily affected parts and confirm they operate properly. If they do not operate properly, part replacement is required.
- Clear the DTCs and road test the vehicle to confirm the condition has been corrected.

TOYOTA PRIUS PHV 2014 PRE-DELIVERY SERVICE CHECK SHEET

October 2013

BEFORE INSPECTION	OK Adjust	UNDER VEHICLE (ON HOIST)			
01 Install Short Pin (see page 2)		01 Remove disc brake anti-rust covers/anti-corrosion wheel film*			
FUNCTIONAL OPERATION		02 Inspect tires for defects/damage			
Apply parking brake and cycle ignition "IG-ON"; place gear selector in reverse;		03 Activate and Initialize Tire Pressure Warning System (TPWS) (see page 2)			
lights and rear defogger. Unlock doors; release fuel door, and release the back O1 Check dome, courtesy, map, and sun visor lights* O2 Check warning/indicator lights, gauges, and horn O3 Check windshield wipers and washers O4 Check headlights, instrument lights, turn signals, emergency flashers, and brake lights O5 Check inside/outside rear view mirror operation/adjustment O6 Check cigarette lighter* and power outlets O7 Check audio/navigation*/backup camera* systems and set clock		04 Install wheel caps* 05 Install front spoiler under cover & rear side spoilers 06 Install rear wheel opening extension pads 07 Inspect for fuel, oil, coolant, and other fluid leaks 08 Inspect under the vehicle for damage, rust, etc. 09 Visually check bolts and nuts on chassis and powertrain for looseness 10 Install rubber body plugs (stored in glove box or console)* 11 Check hybrid transaxle fluid			
08 Verify Entune/Navigation software version (Display Audio, Non-HDD Type only)*	00	A complete road test helps assure customer satisfaction. Drive vehicle over a variety of road surfaces and driving conditions. Check for unusual noise and			
09 Check multi-information display and trip information on center display*		driving parformance			
10 Install shift-lock override button cover* 11 Check sliding roof*		Enter Odometer Readings			
WALKAROUND INSPECTION		01 Check cold engine operation			
Start at left front door. Check window and door lock operation (from mas switch, if equipped). Continue around vehicle in a counterclockwise direction each door and window operation, child door locks, seat belts, interior corlights, luggage compartment contents. Finish by checking headlight aim and into UNDER HOOD checks.	checking dition, all continue	04 Check engine at normal operating temperature			
01 Check Smart Key System		08 Inspect for squeaks and rattles			
(unlocked) position*		FINAL INSPECTION AND CLEANING			
06 Check rear defogger/rear view mirror defogger*		tags, etc. (Remove protective covers just before delivery to customer) 02 Visually inspect all interior parts for installation, damage, fit, dirt, etc. 03 Verify floor mat application and install using retaining clips*			
UNDER HOOD 01 Charles anging ail level	00				
01 Check engine oil level	00000	07 Inspect paint finish for scratches, chips, rust, dents, damage, etc			
BATTERY MAINTENANCE		damage, rust, etc			
01 Perform HV battery check and maintenance		nage 2)			
* Inspect or install when equipped/required.					
Completion and retention of this from is required to comply with Toyota's TECHNICIAN'S SIGNATURE SERVICE		We hereby certify that all items on this form have been checked and corrected for proper operation as required.			
	(PLEASE				
Date Dealer Name		Dealer Code Vehicle Identification Number (Sticker)			


SHORT PIN INSTALLATION

To minimize battery discharge the Short Pin has been removed and is stored in the engine compartment Relay Block. Install the Short Pin and confirm all related DTCs are cleared.

DTC Clearing Procedure

- 1. Connect Techstream to DLC3.
- 2. Cycle the ignition switch to the "IG-ON" position.
- 3. Using Techstream, check any other codes being output.
- 4. Erase DTCs (B1650, B1794, U0155, U0142, and U0100) and Freeze Frame Data.

If any DTCs besides B1650, B1794, U155, U0142, and U0100 remain, repair the applicable system according to the Repair Manual.

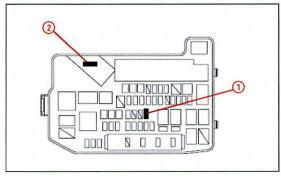

1 Storage Location

2 Installation Location

TPWS ACTIVATION AND INITIALIZATION

Activation Procedure

- 1. Connect Techstream to DLC3.
- 2. Cycle the IG switch to the "IG-ON" position and check that the Low Tire Pressure Warning Light blinks for 1 minute and then remains illuminated.
- 3. Press or remove the valve core to reduce the tire inflation pressure rapidly by 6 psi (0.4 kgf/cm², 40 kPA), or more, within 30 seconds.
- 4. Using Techstream, check for DTCs (C2111-C2114). If no DTCs are stored, continue to step 5. If these DTCs are stored, repeat step 3.
- 5. Adjust all tires to the standard tire inflation pressure, as indicated on the Tire and Loading information label inside the driver's door jamb.
- 6. Check the tire pressure values of all the tires using Techstream. TPWS ECU / DATA LIST / TIREPRESS 1-4

If DTCs C2111-C2114 are present after repeating step 3, lift the vehicle and rotate each tire so that the tire pressure warning valve/sensor is at the top of the wheel well. Then repeat step 3.

Initialization Procedure

Refer to the Repair Manual for the Initialization procedure.

To adjust the tire pressure correctly when the outside temperature is significantly colder than shop temperature, perform a Health Check using Techstream and select the "Compensation Tire Pressure" checkbox. Compensation pressures will be displayed on the Health Check results screen. Adjust the tire pressure when the tires are cold.

FRONT LICENSE PLATE AND MOUNTING BRACKET INSTALLATION


Align holes "A" of the mounting bracket with the dimples on the front bumper cover. Mark the location of holes "B" in the front bumper cover.

- Holes "A" are used for installation of the mounting bracket to the bumper cover.
- Holes "B" are used for installation of the front license plate to the mounting bracket.
- 2. Drill 2 relief holes with a diameter of 11 mm (0.43 in.) at the hole "B" marks on the front bumper cover to prevent the license plate retaining bolt from contacting the cover.
- Install the mounting bracket to the front bumper cover by attaching the 2 self-tapping screws into the dimples.
- Install the front license plate to the mounting bracket using bolts with the following dimensions.

Length: 20.0 — 25.0 mm (0.79 — 0.98 in.) Diameter: 6.0 mm (0.24 in.) Pitch: 1.0 mm (0.04 in.)

NOTICE

- Do NOT pre-drill holes into the bumper.
- Do NOT overtighten the self-tapping screws.

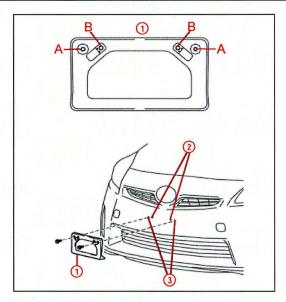

- 1 Mounting Bracket
- 2 Mark and Drill Holes
- 3 Dimples