Rev2

February 1, 2012



 
HID Headlamp Housing Paint Bubble / Poor Appearance

Service

Category Vehicle Exterior

Section Lighting (ext)

Market USA



Applicability

YEAR(S)	MODEL(S)	ADDITIONAL INFORMATION	
2011 – 2013	IS F, IS250, IS250C, IS350, IS350C		

REVISION NOTICE

December 3, 2013 Rev2:

· The Production Change Information section has been updated.

September 24, 2013 Rev1:

- · Applicability has been updated to include additional 2013 model year Lexus vehicles.
- The Production Change Information, Warranty Information, Parts Information, and Repair Procedure sections have been updated.

Any previous printed versions of this bulletin should be discarded.

Introduction

Some 2011 – 2013 model year IS 250/350/250C/350C and IS F vehicles equipped with HID (High Intensity Discharge) headlights may exhibit a paint bubbling/wrinkling condition on top of the LED strip within one or both of the headlight housings. Newly designed headlight units have been developed to address this condition. Follow the procedure in this bulletin to install the updated headlight units.

Production Change Information

This bulletin applies to vehicles produced **BEFORE** the Production Change Effective VINs shown below.

MODEL	PLANT	ENGINE	DRIVETRAIN	PRODUCTION CHANGE EFFECTIVE VIN
	Tabasa		2WD	JTHBF5C2#D5193665
10.050	IS 250 TMK	40D F0F	AWD	JTHCF5C2#D5064017
15 250		4GR-FSE	2WD	JTHBF5C2#D2103197
			AWD	JTHCF5C2#D2036074



L-SB-0005-12

Production Change Information (Continued)

MODEL	PLANT	ENGINE	DRIVETRAIN	PRODUCTION CHANGE EFFECTIVE VIN
IC 250 T-h		000 505	2WD	JTHBE5C2#D5032058
IS 350 Tahara	2GR-FSE	AWD	JTHCE5C2#D5003209	
IS 250C	Thus	4GR-FSE		JTHFF2C2#D2528759
IS 350C	TMK	2GR-FSE	2WD	JTHFE2C2#D2509743
IS F	Tahara	2UR-GSE		JTHBP5C2#D5011225

Warranty Information

OP CODE	DESCRIPTION	TIME	OFP	T1	T2
BD9097	R & R Headlight Units, Transfer Components, & Aim Headlights	2.6	81145-53540 81145-53541 81145-53542 81145-53543 81185-53540 81185-53541 81185-53542 81185-53542 81185-53670 81145-53671 81145-53672 81145-53673 81145-53670 81185-53671 81185-53671	99	15

APPLICABLE WARRANTY

- This repair is covered under the Lexus Comprehensive Warranty. This warranty is in effect for 48 months or 50,000 miles, whichever occurs first, from the vehicle's in-service date.
- Warranty application is limited to occurrence of the specified condition described in this bulletin.



Parts Information

NOTE

- If the headlight assembly does not have visible paint bubbles and only one headlight needs to be replaced (for collision damage repairs, etc.), use the part number for the headlight that the vehicle is currently equipped with. Updated parts are not compatible with prior part numbers.
- If either headlight assembly has visible paint bubbles, replace the headlights in pairs with the NEW part numbers.

MODEL	PART N	IUMBER	DART NAME	QTY
MODEL	PREVIOUS	NEW	PART NAME	QIY
	81145-53540	81145-53544	THE LETTER	1
	81145-53541		Unit, Headlamp, RH	
	81145-53542			
IS 250/350	81145-53543			
15 250/350	81185-53540			1
	81185-53541	81185-53544	Unit Headlems I H	
	81185-53542	81185-53544	Unit, Headlamp, LH	
	81185-53543	î i		
	81145-53670		Unit, Headlamp, RH	1
	81145-53671	81145-53674		
. IMI	81145-53672			
	81145-53673			
10.0500/0500	81145-53543	81145-53544		
IS 250C/350C	81185-53670		Unit, Headlamp, LH	
	81185-53671	81185-53674		1
	81185-53672			
!= "!	81185-53673	,.		
	81185-53543	81185-53544		
	81145-53670	81145-53674	Unit, Headlamp, RH	1
	81145-53671			
IS F	81145-53672			
	81145-53673			
	81185-53670		Hate Handleye III	
• • • · · · · · · · · · · · · · · · · ·	81185-53671	81185-53674		1
	81185-53672		Unit, Headlamp, LH	
	81185-53673			



Required Tools & Equipment

SPECIAL SERVICE TOOLS (SST)	PART NUMBER	QTY
Plastic Pry Tool Kit*	00002-06020-02	1

^{*} Essential SST.


NOTE

Additional SSTs may be ordered by calling 1-800-933-8335.

REQUIRED MATERIAL	QUANTITY
Protective Tape	As Needed

Repair Procedure

Confirm vehicle has the headlight housing paint bubble condition (see Figure 1 for an example).
If a poor appearance is found, continue to step 2. If not, this bulletin does NOT apply.
Figure 1.

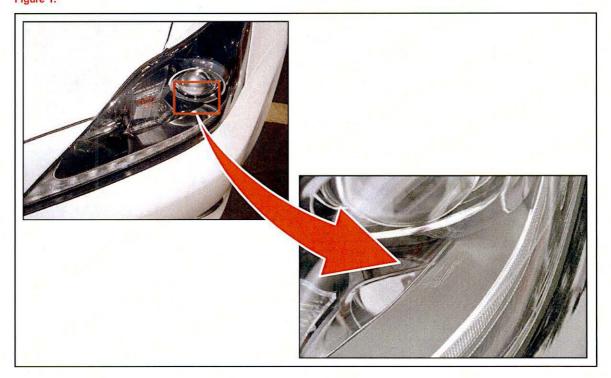



Repair Procedure (Continued)

- 2. Replace both headlight units.
 - A. Remove both headlights.

L-SB-0005-12

Refer to the Technical Information System (TIS), applicable model and model year Repair Manual:

Vehicle Exterior - Lighting (ext) - "Lighting: Headlight Assembly: Removal"

- · 2011 / 2012 / 2013 IS 250/350
- · 2011 / 2012 / 2013 IS 250C/350C
- 2011 / 2012 / 2013 IS F
- B. Disassemble the headlight assemblies.

Refer to TIS, applicable model and model year Repair Manual: Vehicle Exterior – Lighting (ext) – "Lighting (ext): Headlight Assembly: Disassembly"

- · 2011 / 2012 / 2013 IS 250/350
- 2011 / 2012 / 2013 IS 250C/350C
- 2011 / 2012 / 2013 IS F
- C. Reassemble the headlight assemblies using the new headlight units.

Refer to TIS, applicable model and model year Repair Manual: Vehicle Exterior – Lighting (ext) – "Lighting: Headlight Assembly" Reassembly"

- 2011 / 2012 / 2013 IS 250/350
- 2011 / 2012 / 2013 IS 250C/350C
- 2011 / 2012 / 2013 IS F
- D. Install the completed headlight assemblies with the new headlight units.

Refer to TIS, applicable model and model year Repair Manual: Vehicle Exterior – Lighting (ext) – "Lighting: Headlight Assembly: Installation"

- 2011 / 2012 / 2013 IS 250/350
- 2011 / 2012 / 2013 IS 250C/350C
- 2011 / 2012 / 2013 IS F



Repair Procedure (Continued)

E. Adjust the headlight assemblies.

Refer to TIS, applicable model and model year Repair Manual: Vehicle Exterior – Lighting (ext) – "Lighting (ext): Headlight Assembly: Adjustment"

- 2011 / 2012 / 2013 IS 250/350
- · 2011 / 2012 / 2013 IS 250C/350C
- 2011 / 2012 / 2013 IS F
- 3. Confirm headlight operation.