



File in Section: -

Bulletin No.: PIC5757

Date: October, 2012

Service Bulletin

PRELIMINARY INFORMATION

Subject: Blower Motor Inoperative and/or Water In Blower Motor Control Module Area DTC B0193

Models: 2013 Chevrolet Malibu eAssist


The following diagnosis might be helpful if the vehicle exhibits the symptom(s) described in this PI.

Condition/Concern

A customer or technician may indicate the blower motor is inoperative and/or there is water in the blower control module motor area. DTC B0193 may also be set.


Recommendation/Instructions

If this concern is duplicated inspect the blower motor, blower motor control module and connectors for signs of water. If water is found it will be necessary to reseal the plenum deflector (see images below) and then replace parts and repair connectors as needed. Remove the air inlet grille to access the plenum water deflector.

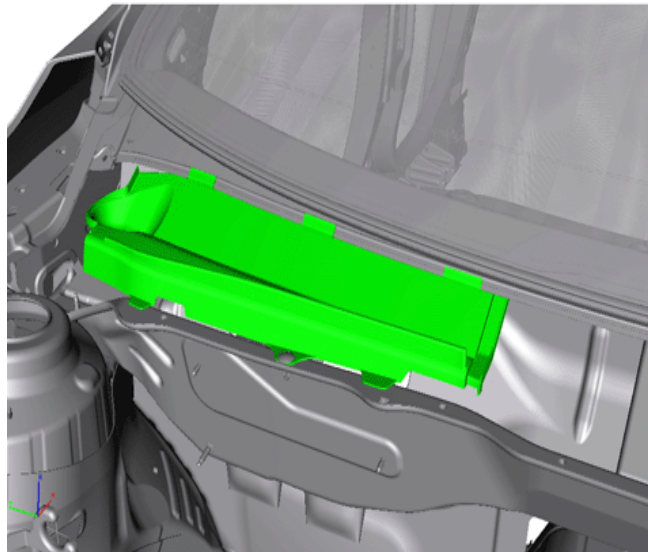

2919801

Remove the plenum water deflector and add a closed cell foam strip (1/4" tall x 3/8" wide acquired locally) across the entire top of the deflector. Reinstall water deflector and air inlet grille.

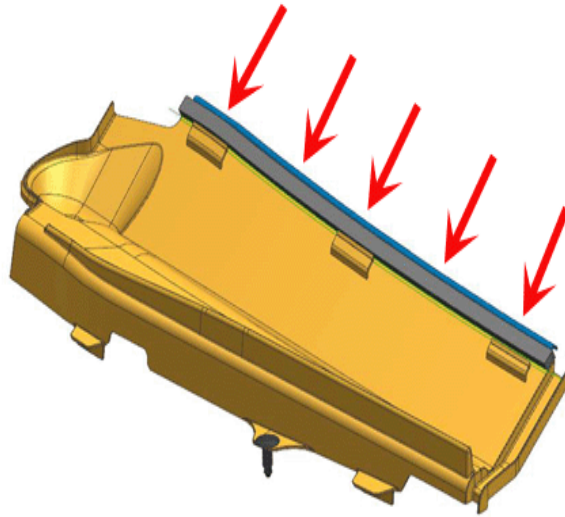

2919855

Warranty Information

For vehicles repaired under warranty use:

| Labor Operation | Description | Labor Time |
|-----------------|--------------------------|------------|
| D1324 | Blower Motor Replacement | 0.3 hr |

Please follow this diagnostic or repair process thoroughly and complete each step. If the condition exhibited is resolved without completing every step, the remaining steps do not need to be performed.