 
ATTENTION:

GENERAL MANAGER PARTS MANAGER CLAIMS PERSONNEL SERVICE MANAGER

IMPORTANT - All Service Personnel Should Read and Initial in the boxes provided, right.





SERVICE BULLETIN

APPLICABILITY: 2012MY Forester, Impreza and WRX Models

Equipped with Fujitsu Ten Audio / Navigation

Systems

NUMBER:

15-155-12R

DATE: 08/14/12

REVISED: 11/09/12

SUBJECT: Fujitsu Ten (F10) Audio/Navigation Unit SD Card Exchange Information

Including Diagnosis and Troubleshooting for Specific Software-Related Conditions Which May Be Corrected Through A Programming Update

INTRODUCTION

The purpose of this bulletin is to provide:

- Specific symptom identification information.
- Proper procedures for ordering the appropriate exchange SD (memory) cards.
- Reprogramming procedures for the audio/navigation unit once the exchange SD card is installed (includes the procedure for determining the unit's current software version).

KEY POINTS TO REMEMBER

- Always verify the customer's specific concern. If their condition is not one of those outlined in this bulletin, the information here is most likely not applicable to the customer's concern. Instead, refer to the Subaru/Fujitsu Ten (F10) SD card Navigation System Technical Support Guide/Troubleshooting Guide as found using STIS > Online Reference > Troubleshooting Guide.
- Inspect the SD card closely for any evidence of physical damage. Damaged or altered SD cards are not a matter for warranty. Any damaged or altered SD cards returned to Fujitsu Ten may be subject to chargeback.
- Advise the customer their replacement SD card will include updated software to address operational conditions with the audio unit only. Navigation system maps supplied with the exchange SD card will match those on the customer's current SD card. Map upgrades are not provided under the terms of the exchange program.
- Always use the SD card that matches the head unit (H/U) application precisely as shown on the H/U and SD card Identification chart. Use of an incorrect SD card can result in irreparable damage to the H/U. Such damage is not covered under the terms of the exchange program. Returned units found to have this type of damage may be subject to chargeback.

Continued...

CAUTION: VEHICLE SERVICING PERFORMED BY UNTRAINED PERSONS COULD RESULT IN SERIOUS INJURY TO THOSE PERSONS OR TO OTHERS.

Subaru Service Bulletins are intended for use by professional technicians ONLY. They are written to inform those technicians of conditions that may occur in some vehicles, or to provide information that could assist in the proper servicing of the vehicle. Properly trained technicians have the equipment, tools, safety instructions, and know-how to do the job correctly and safely. If a condition is described, DO NOT assume that this Service Bulletin applies to your vehicle, or that your vehicle will have that condition.

SUBARU OF AMERICA, INC. IS "ISO 14001 COMPLIANT"

The international standard for excellence in Environmental Management Systems. Please recycle or dispose of automotive products in a manner that is friendly to our environment and in accordance with all local, state and federal laws and regulations.

Note: The information in this bulletin is only applicable to 2012MY Forester, Impreza and WRX models with the H/Us outlined in red on the following identification chart. The chart is supplied for reference only. All the H/Us used in 2013MY Legacy and BRZ models contain the latest SD card software.

SYSTEM IDENTIFICATION

Subaru / Fujitsu Ten SD Card Navigation Units Head Unit (H/U) and SD Card Identification									
	Vehicle	IMPREZA	FORESTER	IMPREZA WRX	BRZ	Legacy			
Head Unit	Subaru Part Number	86271 <u>FJ</u> 600	86271 <u>SC</u> 600	86271 <u>FG</u> 600	86271 <u>CA</u> 620	86271 <u>AJ</u> 67A			
	ID Number	FM601US	FP606US	FW602US	FA601US	FB678US			
	Look	0 disi	O	O SEE	Odisi				
SD Card (SDHC 4GB)	Subaru Part Number	86283 <u>FJ</u> 600	86283 <u>SC</u> 600	86283 <u>FG</u> 600	86283 <u>CA</u> 620	86283 <u>AJ</u> 67A			
	Label	SUBARU escasifusco For North America 4 Map ver. 2010 Q3 Subanac NUFA100001 Please do not erase map data	SUBARU A 86283SC600 For North America 4 Map ver. 2010 Q3 CAMB NUFCOMMEN Please do not erase map data	SUBARU A 86283FG600 For North America 4 Map ver. 2010 Q3 CLABB NIFDO0001 Please do not erase map data	SUBARU A 86283CA620 For North America 4 Map ver. 2011 Q3 Gas CLASS NUFFIHHH Please do not erase map data	SUBARU 60283AJ67A For North America of Map ver. 2011 Q3 Map ver. 2011 Q3 CLASS NUFSTITITI Please do not erase map data			

SERVICE PROCEDURE / INFORMATION

The 7 customer reported conditions outlined in the following pages are strictly related to the function of the H/U's operating software contained in the removable SD card. Once any of these specific conditions are verified, an exchange SD card only must be ordered. Complete exchange units (H/U and SD card) should not be used to address these listed conditions. If the condition is other than those listed in this bulletin, use of a complete exchange unit may be appropriate. After verification of the condition and confirming the applicability to this bulletin, the Fujitsu Ten Advance Exchange Fax Form available on Subarunet>Service>Forms will need to be printed and completed. Always download and use the latest form as use of an older version of the form may result in an incorrect shipment and needless repair delay.

IMPORTANT: It is critical to complete the entire form. In addition to the information which has been requested on the form in the past, new fields for the H/U part number, SD card part number and the Software Version circled below **must be filled in accurately**. See steps 9 -13 in the reprogramming instructions contained later in this bulletin for the procedure to determine the Software Version.

The **completed** form must be faxed to Fujitsu Ten at: 1-800-438-5410.

Step 1: Initial Operations:	System / AVN SD Card Navi Syste	m If you have any questions, you may contact us at 1-800-237-5413		
Old you duplicate customer complaint? Yes No	OmTom Navigation System AVN SD Card Navig Unit PND Unit Unit with SD card Subaru Part Number:	May only be used for econditions outlined in Subaru TSB 16-186-12		
No Case #:	July RD Card is model as	ecfic. Please verify if the part # is correct.		
(month),(date), Occur only onceAlways occur Where did problem occur? (Ex. Ordinary	e in date and time of occurrence, Check all that a(clock time) times within the past road, Freeway, Underground parking etc.) d driving, Driving at rough road, Parking)	BLUETOOTH (Phone) [Will not pair: Phore Carrier Mare		
What did customer operate? (Ex. ACC-O Discription of problem (Please use as m		Can't Hear: Receiver Caller Dounds Garbled Address book will not wansfer Other Explain:		
RADIO CD/DVD AM, Station: Won't Accept CD FM, Station: Won't Play HD, Station: CD Skips No Sound No Sound No IPoor Reception No Ike/Static Sound cuts injour	NAVIGATION No Voice Quidance No Display	Will not sein: Device		
Sound cuts in/out Shows Error Other Explain:	Overall Navi operation slow Glow Response Other Navi Function Other Display Function List problem:	Won't Play		
Other Audio Problem (DVD, USB, IPod, AUX) Explair:	Other (Explain)	PND Battery PND stops charging PND does not charge		
Stop 4: WARRANTY: YES N	O Software Version:			
Dealer Code:	Dept: Repair Order Number: Mileage:			
Date of First Use:	Phone: Fax:			

Condition 1:

When the "Auto. P" button is pressed on the "Settings" screen in AM or FM mode, a small "pop" noise is heard through the speakers. This condition may occur when the same radio station preset is saved twice in the "Preset" memory.





| 1051kHz | Station 03 | Station 03 | Station 03 | Station 04 | Station 05 | Station 05 | Station 05 | Station 06 | Station 07 | Statio

Press "Audio" Button

Press "FM" button





Press the "Settings" button

If the same FM preset is saved twice, change one to a different station



Speakers make a small "pop" noise

Condition 2:

Song titles are not shown in iPod mode. This condition may occur when the "Search" button on the "iPod Main" screen is pressed while the "Searching iPod Please wait..." message is displayed.



Connect with iPod





Press "Audio" Button



Press "V" or "down arrow" button



Searching iPod starts. Song lists will not be displayed if "Search" button is pressed again before the function is completed



iPod Mode



No song titles are shown

Condition 3:

CD playback is delayed for approximately 10 seconds after loading a CD or the CD mode is selected.

An audio disc bearing one of the marks below can be played.













| 1051kHz | Station 03 | Station 03 | Station 01 | Station 02 | Station 02 | Station 01 | Station 01 | Station 01 | Station 01 | Station 02 | Station 02 | Station 02 | Station 03 | Station 05 | Station 05 | Station 05 | Station 06 | Station 07 | Statio

Press "Audio" Button

Press "CD" button



CD playback takes about 10 seconds to start






CD Mode

Condition 4:

FM radio can still be heard even if the audio unit is in "Audio Off" mode. This condition happens after "Delete Personal Data" button is pressed and cycling the ignition key off and back on again.



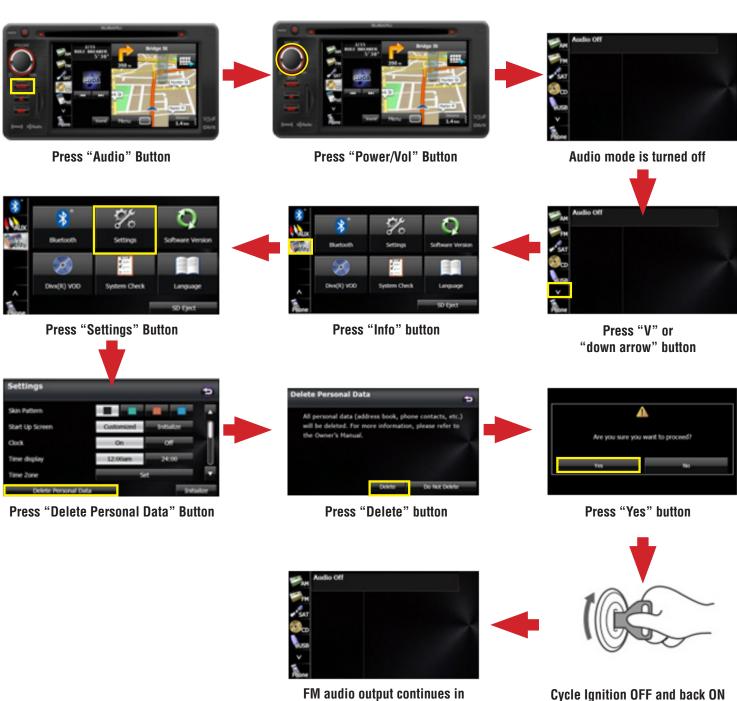


"Audio Off" mode

Condition 5:

 "I Agree" button cannot be selected on the Caution screen.










Start the vehicle

"Start-Up" screen is displayed



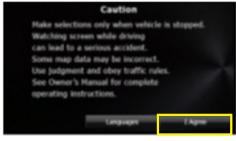

"I Agree" button does not work

Condition 6:

In XM mode, the keypad appears normal but is inoperative while the vehicle is in motion. Once the vehicle is stopped, the keypad operates normally.





Press "Audio" Button

Press "SAT" button







Press "Direct" button

Press "Preset" button



Although the keypad appears to be functional (not grayed-out), it does not operate unless the vehicle is stopped.

Condition 7:

USB Flash Memory device is not recognized.



Display does not change to USB icon.





Connect USB memory device.



Press "Audio" Button





USB memory is not recognized.

AUDIO / NAVIGATION SYSTEM REPROGRAMMING PROCEDURE



This procedure **MUST BE FOLLOWED CAREFULLY** after installation of the exchange SD card to update the audio / navigation system and complete the repair.

CAUTION: Insure the vehicle battery is fully charged before initiating this process. **DO NOT** connect any battery chargers or auxiliary power supply as part of this procedure. Be sure to record the customer's radio station presets.

Save and re-use the exchange SD card's packaging to use when returning the original SD card. A padded return shipping envelope will also be provided with the exchange part. Include a copy of the Fujitsu Ten Advance Exchange Fax Form in the return package. We recommend using a traceable freight carrier for the SD card's return shipment. Be sure to attach a copy of the freight invoice including the tracking number to the repair order for future reference. Failure to return an exchange SD card within 30 days will result in a significant chargeback.

Shipping Address:

Fujitsu Ten Corporation of America

20200 S. Western Avenue

Torrance, California 90501

Step 1: Confirm the audio/navigation unit is OFF and the ignition switch is OFF.

Step 2: If you are trying to repair "Condition 5, the I Agree button cannot be selected", Step 2 must be performed as shown below. For all the other symptoms, skip over this step and proceed to Step 3.



Step 3: Eject the failed SD card from the H/U by pressing the SD card slightly then pulling it out of the slot.

NOTE: This is the only time the SD card should be removed in this manner. In all other cases, the SD card must be ejected following the procedure outlined in the Owner's Manual.

Step 4: To distinguish between the old and the replacement exchange SD card, a GREEN dot has been added to the label as shown below. Use the chart below to verify the part number is correct for the vehicle application you are working on before proceeding further.



Step 5: Insert the exchange SD card into the H/U.

Step 6: If you are trying to repair "Condition 5, the I Agree button cannot be selected", Step 6 must be performed next which is to re-install the Back-Up Fuse previously removed in Step 2. For all the other symptoms, skip over this step and proceed to Step 7.

Step 7: Turn the ignition key to the ACC position. NOTE: **DO NOT START THE ENGINE.**

CAUTION: Until the programming process is completed, do not turn the ignition key off or attempt to start the engine. Any interruption during the programming process can damage the unit's internal navigation data in which case, the audio unit will need to be replaced. After turning the ignition key on, the screen will remain black for about a minute while the reprogramming process is running. Once the status/loading bars complete and the "Version Up OK" message appears, cycle the ignition key off then back on to the ACC position.






Step 8: When the programming process has completed, the system will display the "Start-Up" screen.




Step 9: After the "Start-Up" screen, the "Caution" and "End User License" screens will appear next. Press "OK" then, press "Accept" as shown below.

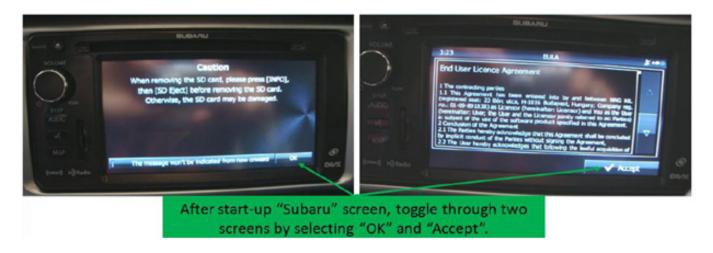

Step 10: Press the "Audio" button.




Step 11: Press the "V" (or "down arrow") button then the "Info" button

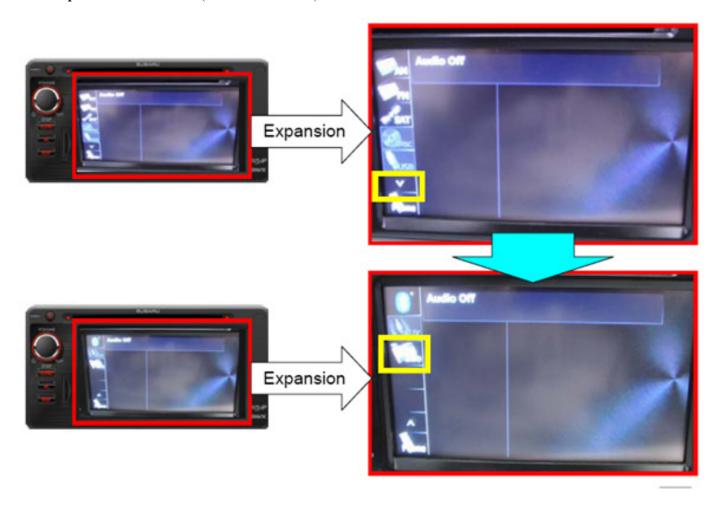

Step 12: Press the "Software Version" button.



Step 13: Verify the software version displayed is included in the chart shown below. If the version number matches, the reprogramming procedure is complete. If not on the list, repeat the programming procedure starting with Step 1.

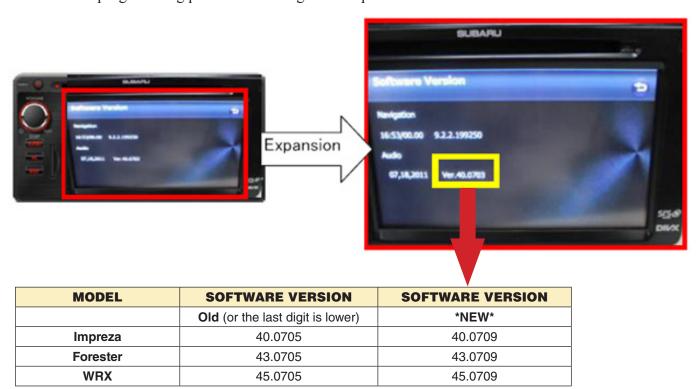

IMPORTANT REMINDERS:

- Once the reprogramming procedure is complete, re-use the exchange SD card's packaging to return original SD card to Fujitsu Ten. A padded return shipping envelope has been provided with the exchange part. Include a copy of the Fujitsu Ten Advance Exchange Fax Form in the return package. We recommend using a traceable freight carrier for the SD card's return shipment. Always attach a copy of the freight invoice including the tracking number to the repair order for future reference. Failure to return an exchange SD card within 30 days will result in a significant chargeback.
- Be sure to reset customer's radio station presets.

WARRANTY / CLAIM INFORMATION

LABOR DESCRIPTION	LABOR OPERATION#	FAIL CODES	LABOR TIME
Reprogramming for Fujitsu Ten Audio / Navigation System	A067-338	ZOS-48	0.3

Bulletin Number: 15-155-12R; Date: 11/09/12