

Thor Motor Coach Recall Repair Instructions



US Recall # 12V-516 Canadian Recall # 2012-358

Description/Title: **Iota ITS-50R Transfer Switch**

Service Campaign # : **RC000064** Released Date: **11/7/2012**

Failure Code: **TMCRC80430Y Inspect
TMCRC80430V Replace** Document Date: **11/7/2012**

Time Allowed: **.2 Inspect - 1.0 Replace** Document Revision: **A**

SUMMARY: All of the motorhomes subject to this recall campaign are equipped with an Iota ITS-50R Transfer Switch which may be experiencing heat related failures when exposed to elevated electrical loads associated with RV use in higher ambient temperatures. The connections at the buss bar inside of the switch are not adequate resulting in elevated operating temperatures. This potentially could result in a fire. In the event of a fire, there is a potential for property damage, personal injury or death.

REMEDY: TMC will inspect and/or replace the Iota ITS-50R Transfer Switch.

AFFECTED VEHICLES:

Model	Model Years
Chateau (Kodiak Chassis)	2008 - 2010
Dutchmen (Kodiak Chassis)	2009
Hurricane	2008 - 2010
Windsport	2008 - 2009
Magellan	2009
Fun Mover	2008 - 2009
Presidio	2008 - 2009
Mandalay	2008 - 2010

REIMBURSEMENT AND PARTS REQUIRED:

Furrion ATS-50 Transfer Switch TMC Item Number: 0255378

Dealers can contact the Thor Motor Coach Customer Service Department at 1-877-500-1020 or order the required parts and file a claim via the TMC Advantage Portal at www.thormotorcoachservice.com.

DIRECTIONS:

1. Verify the motorhome is subject to the recall. This can be done either by logging the VIN # into the Thor Advantage Portal or calling tech support at 877-500-1020.
2. Verify the motorhome has the Iota ITS-50R transfer switch installed. If it has already been replaced by another brand, stop, the transfer switch does not need to be replaced.
3. Replace the transfer switch according to the manufacturers instructions on the documentation supplied with the new transfer switch.