L-SB-0014-13

March 12, 2013



Repair Manual Supplement: SRS DTCs Not Listed in Repair Manual

Service

Category Vehicle Interior

Section Supplemental Restraint Systems

Market USA



Applicability

| YEAR(S) | MODEL(S) | ADDITIONAL INFORMATION | |
|---------|----------|------------------------|--|
| 2012 | CT200H | | |

Introduction

Some 2012 model year Lexus CT 200h vehicles may set SRS Diagnostic Trouble Codes (DTCs) that are not listed in the Repair Manual. Refer to the chart in this bulletin to diagnose these DTCs.

Warranty Information

| OP CODE | DESCRIPTION | TIME | OFP | T1 | T2 |
|---------|----------------------------|------|-----|----|----|
| N/A | Not Applicable to Warranty | _ | = | - | |

Required Tools & Equipment

| REQUIRED EQUIPMENT | SUPPLIER | PART NUMBER | QTY |
|--------------------|----------|-------------|-----|
| Techstream 2.0* | | TS2UNIT | |
| TIS Techstream | ADE | TSPKG1 | 1 |
| Techstream Lite | | TSLITEDLR01 | |

^{*} Essential SST.

NOTE

- Only ONE of the Techstream units listed above is required.
- Software version 8.00.034 or later is required.
- Additional Techstream units may be ordered by calling Approved Dealer Equipment (ADE) at 1-800-368-6787.



Repair Manual Supplement: SRS DTCs Not Listed in Repair Manual

SRS DTC Cross Reference List

If an SRS DTC set is not listed in the Repair Manual, refer to the chart below. Follow the diagnostic procedures listed in the Repair Manual for the corresponding Repair Manual DTC.

| SET DTC | DETECTION ITEM | REPAIR MANUAL DTC |
|---------|---|-------------------|
| B1603 | Front Satellite Sensor Bus RH Initialization Incomplete | <u>B1610</u> |
| B1608 | Front Satellite Sensor Bus LH Initialization Incomplete | <u>B1615</u> |
| B1643 | Side Satellite Sensor Bus RH Initialization Incomplete | B1630 |
| B1648 | Side Satellite Sensor Bus LH Initialization Incomplete | B1635 |