

Reference SSM61297

LR4 / L319

Models Range Rover / L322
Range Rover Sport / L320

Title Clock resets to default value 12.00am and date
01/01/2009

Category Electrical

Last modified 24-Jan-2013 00:00:00

Symptom 204000 Instrumentation

Issue: A customer may report that intermittently the Instrument Pack clock changes setting to read time 12.00am and date 01/01/2009 or the time remains correct but switches between a 12hr /24hr format and vice versa when not requested or changes from MM/DD/YY// DD/MM/YY format and vice versa when not requested.

Cause: Body Control Module (BCM) intermittently resets to the default value.

Action: Carry out the following steps:

- Content
1. Check that the concern is not as a result of intermittent low battery voltage by testing the battery and all power and earth connections. Rectify if necessary.
 2. Check that the power and earth connections to the Body control Module have good continuity and correct readings. Rectify if necessary.
 3. If no fault is found with steps 1 to 2, replace the Body Control Module if the vehicle is within the VIN range below.

Discovery/LR4 AA 528840–CA623748

Range Rover Sport AA 233855– CA749082

Range Rover AA 317628– CA381305