

	GROUP Brake System	MODEL 2011MY Sorento (XM)
	NUMBER PS252	DATE May 2013
 		
SUBJECT: 2011MY SORENTO STOP LAMP SWITCH INOPERATIVE AFTER PERFORMING CAMPAIGN SC098		

This article provides information regarding a small number of nonfunctioning stop lamp switches in Sorento (XM) vehicles, after performing Voluntary Safety Recall Campaign SC098. It is possible that in some cases, as a result of a previous improper repair, an incorrect stop lamp switch, originally supplied only for 2006-07MY Sorento (BL) vehicles, was installed in 2011MY Sorento vehicles. The stop lamp switch in question has a pigtail (see image) and installation of this pigtail into the new solid state switch results in a reversal of polarity at the switch. Polarity is critical for the correct operation of the new switch and, therefore, it will not function as intended if the pigtail is used.

If you encounter a situation as described above, remove the switch and pigtail from the vehicle's wiring harness and discard them. Plug the vehicle's wiring harness directly into the new stop lamp switch as described in Voluntary Safety Recall Campaign SC098. Once installation is complete, verify proper operation of the stop lamps.



P/N 93810 3K300QQK
Only applies to 2006-07 Sorento (BL)
Do not use in any other application