



GROUP

Body

MODEL

2011-2013 Optima
(TF & QF)

NUMBER

PS235

DATE

January 2013



TECHNICAL OPERATIONS

**SUBJECT: HORN CHIRP AND PARKING LAMPS INOP WHEN
LOCKING DOORS WITH RKE FOB**

If you encounter a customer complaint relating to the vehicle not producing an audible tone, or horn chirp, and the parking lamps not flashing when locking the vehicle with the RKE fob, check to make sure the rubber hood stopper (A) is in place on the hood. The rubber stopper depresses the hood switch (B) and if not in place, may cause this condition, and may also prevent the alarm system from operating correctly.

