

[1harness chafe under headlamp\(1\).JPG](#)

[1harness chafe under headlamp\(2\).JPG](#)

Reference	SSM63277
Models	Range Rover Sport / L320 LR4 / L319
Title	Air suspension fault, warning light on with possibility of additional warning li
Category	Chassis
Last modified	19-Aug-2013 00:00:00
Symptom	304000 Suspension System
Content	<b><u>Note: This only applies to 10my vehicles onwards</u></b>
	<u>Issue</u> Air suspension fault, warning light on. Fault codes starting with C1A especially C1A36-01 logged. Possibility that additional warning lights may be displayed and additional fault codes stored.
	<u>Cause</u> The harness has been incorrectly routed and is pressing against the washer filler tube causing insulation damage and a short circuit/open circuit
	<u>Action</u> If on initial investigation the air suspension warning light is on and any fault code starting C1A is found using diagnostic equipment especially C1A36-01 it is suggested that you check the harness routing under the LH headlamp. See attached photo for failure mode. Repairs damaged wires using the harness repair kit and reposition the harness to prevent reoccurrence. Assured vin numbers, Discovery4/LR4 633241 Range Rover Sport 761054. Please submit EPQRs if you see a failure after assured vin numbers.





