



GROUP
BODY

MODEL
2011-2012MY
Sorento (XMa)

NUMBER
099 (REV 1, 11/08/2013)

DATE
June 2013

TECHNICAL SERVICE BULLETIN

SUBJECT: SORENTO FUEL FILLER DOOR OPERATION UPGRADE

* NOTICE

This bulletin has been revised to include additional information. New/revised sections of this bulletin are indicated by a black bar in the margin area.

This bulletin provides information related to some Sorento (XMa) vehicles, produced from October 15, 2009 to September 29, 2011, which may exhibit a hard to open fuel filler door. Follow the procedure outlined in this bulletin to upgrade the operation of the fuel filler door.



Fuel Filler Door

File Under: <Body>

Circulate To: General Manager Service Manager Parts Manager
 Service Advisor(s) Technician(s) Body Shop Manager Fleet Repair


SUBJECT: SORENTO FUEL FILLER DOOR OPERATION UPGRADE

Service Procedure:


1. Open the fuel filler door and place the cap on the holder.

***NOTICE**


Insert shop towel just inside fuel filler neck to prevent foreign materials from falling in during service procedure.

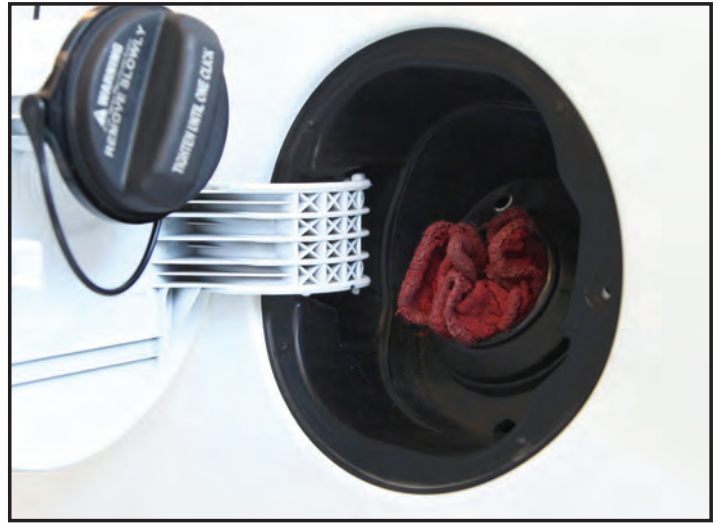

2. Inspect the rubber tube and identify the location of the parallel slits.

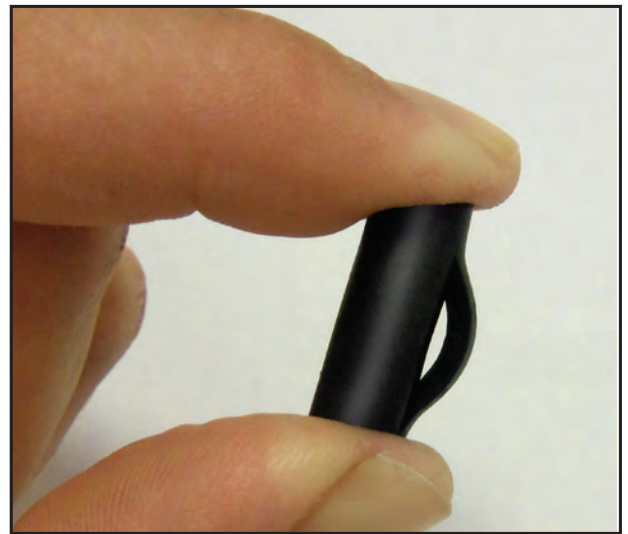

3. Locate the fuel filler door spring arm.

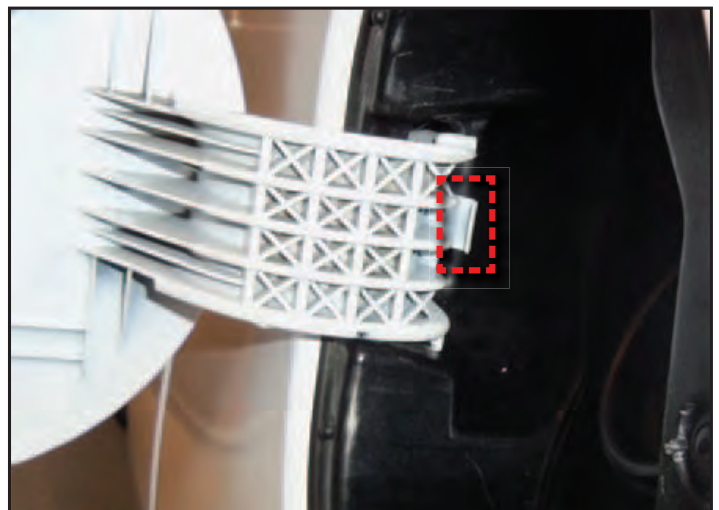


SUBJECT: SORENTO FUEL FILLER DOOR OPERATION UPGRADE

4. Insert the rubber tube onto the fuel filler door spring arm. Make sure the spring arm goes through both parallel slits in the rubber tube, as shown.

***NOTICE**

Fuel filler door removed for demonstration purposes only. Removal is not required for this procedure.

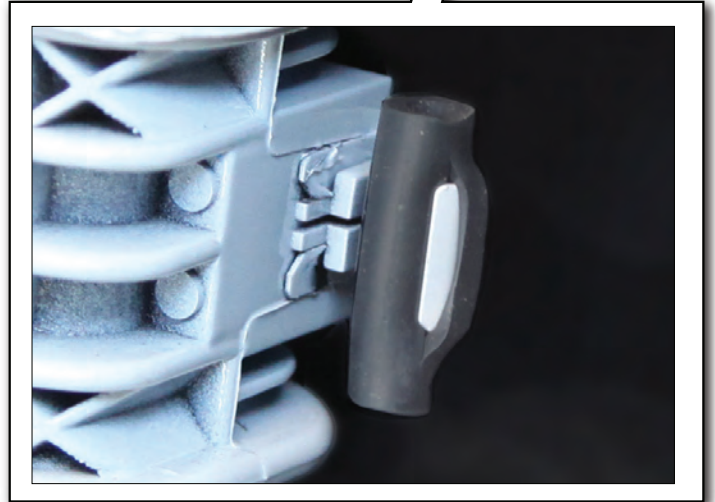


SUBJECT: SORENTO FUEL FILLER DOOR OPERATION UPGRADE

4. (Continued)

DO NOT install the rubber tube in between the spring arms without passing the spring arm through the tube slits, as shown.



DO NOT install the rubber tube around the outside of the spring arm, as shown.

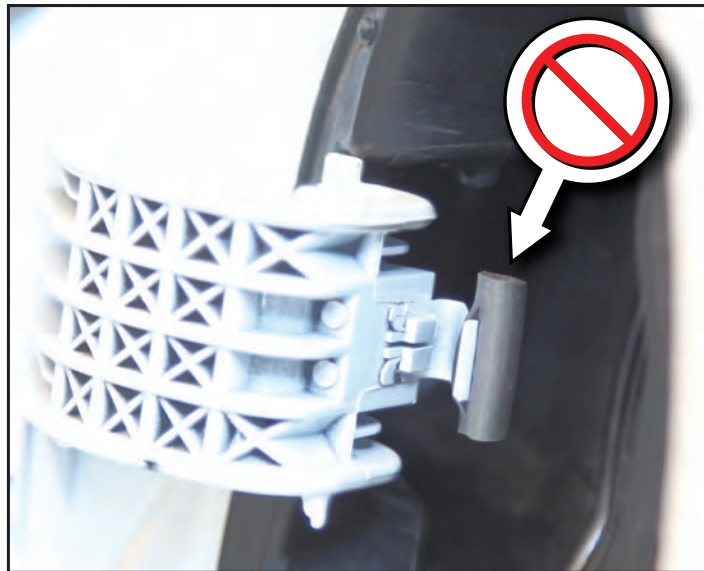

5. Remove shop towel from fuel filler neck and replace fuel cap.


6. Test the operation of the fuel filler door to verify proper operation.

SUBJECT: SORENTO FUEL FILLER DOOR OPERATION UPGRADE

AFFECTED VEHICLE PRODUCTION RANGE:

Model	Production Date Range
Sorento (XMa)	From October 15, 2009 to September 29, 2011

REQUIRED PART:

Part Name	Part Number	Qty	Figure
Rubber Tube	69533 2P000QQK	1	

STANDARD WARRANTY CLAIM INFORMATION:

Claim Type	Causal P/N	Qty.	N Code	C Code	Repair Description	Labor Op Code	Op Time	Replacement Part No.	Qty
W	69510 2P000	0	N93	C24	(TSB BOD 099) FUEL DOOR UPGRADE	69530F00	0.2 M/H	69533 2P000QQK	1