



Service Bulletin

PRELIMINARY INFORMATION

Subject: Power Steering Control Module DTC U0415 Symptom 00

Models: 2014 Cadillac CTS Sedan

Condition/Concern

When diagnosing a CTS Sedan it may be noticed that there is a U0415 sym00 set in the Electronic Power Steering Control Module (EPSCM).

Recommendation/Instructions

DTC U0415 sets in the EPSCM due to an invalid signal being received from the Electronic Brake Control Module (EBCM). The signal goes to invalid when in reverse and the EPSCM sets DTC U0415 after being in reverse for 5 seconds.

DTC U0415 will NOT turn on any warning lights and will NOT cause any drivability issues. The DTC will set in history, can be cleared, and will not set until shifted into reverse again.

At this time, please ignore this DTC. Engineering is aware of this issue and is working toward a resolution. Once a solution is available, this PI will be updated with additional details.

GM bulletins are intended for use by professional technicians, NOT a "do-it-yourselfer". They are written to inform these technicians of conditions that may occur on some vehicles, or to provide information that could assist in the proper service of a vehicle. Properly trained technicians have the equipment, tools, safety instructions, and know-how to do a job properly and safely. If a condition is described, DO NOT assume that the bulletin applies to your vehicle, or that your vehicle will have that condition. See your GM dealer for information on whether your vehicle may benefit from the information.



WE SUPPORT VOLUNTARY TECHNICIAN CERTIFICATION