



Service Bulletin

PRELIMINARY INFORMATION

Subject: Misfire After Camshaft Replacement On The AFM Cylinders 1 4 6 And 7(Check The Part Number On The End Of The Camshaft)

Models: 2007-2013 Chevrolet Express Silverado Suburban
2007-2013 GMC Savana Sierra Yukon
4.8L L20 5.3 LC9 6.0L L96

The following diagnosis might be helpful if the vehicle exhibits the symptom(s) described in this PI.

Condition/Concern

You may encounter misfires on cylinders 1, 4, 6 and 7. Inspect the camshaft part numbers.

If you are replacing the camshaft on the above vehicles or engine the following will be helpful.

Recommendation/Instructions

If the cam shaft is being replaced, make sure the number on the cam shaft matches what is on the box.

The last 4 digits of the part number are stamped on the end of the cam.

12625437 L20 4.8L = 5437 is stamped on the end of the cam

12626660 L96 6.0L = 6660 is stamped on the end of the cam

12625436 LC9 5.3L = 5436 is stamped on the end of the cam

Please follow this diagnostic or repair process thoroughly and complete each step. If the condition exhibited is resolved without completing every step, the remaining steps do not need to be performed.

GM bulletins are intended for use by professional technicians, NOT a "do-it-yourselfer". They are written to inform these technicians of conditions that may occur on some vehicles, or to provide information that could assist in the proper service of a vehicle. Properly trained technicians have the equipment, tools, safety instructions, and know-how to do a job properly and safely. If a condition is described, DO NOT assume that the bulletin applies to your vehicle, or that your vehicle will have that condition. See your GM dealer for information on whether your vehicle may benefit from the information.



WE SUPPORT VOLUNTARY TECHNICIAN CERTIFICATION