



Service Bulletin

PRELIMINARY INFORMATION

Subject: Intermittent IPC Backlight Flash Or IPC Inoperative Code U0155 May Be Set

Models: 2012-2013 Chevrolet Sonic

This PI was superseded to update recommended field. Please discard PIC5615A.


The following diagnosis might be helpful if the vehicle exhibits the symptom(s) described in this PI.

Condition/Concern

A customer may comment that intermittently the IPC may go inoperative and the only thing working is the check engine light or the IPC backlighting intermittent flashes on and off. Upon inspection the technician may also find code U0155 set.

Recommendation/Instructions

Before performing diagnostics, inspect fuse F26DA in the IP fuse block for a spread terminal and a damaged fuse. Upon inspection if the terminal is found to be spread, see the latest version of PIC5813 for terminal repair information.

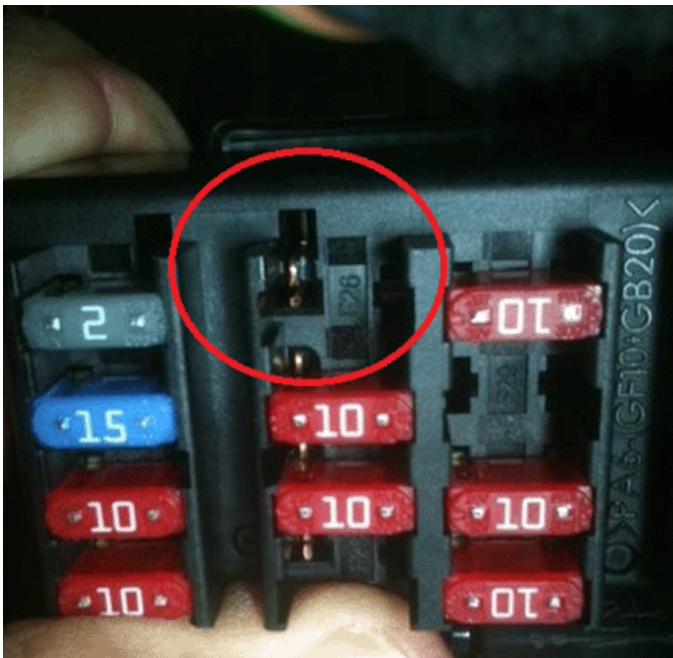

Warranty Information

For wiring repairs covered under warranty, please refer to latest version of bulletin 10-00-89-005 for warranty information on wire/connector repairs.

Please follow this diagnostic or repair process thoroughly and complete each step. If the condition exhibited is resolved without completing every step, the remaining steps do not need to be performed.

GM bulletins are intended for use by professional technicians, NOT a "do-it-yourselfer". They are written to inform these technicians of conditions that may occur on some vehicles, or to provide information that could assist in the proper service of a vehicle. Properly trained technicians have the equipment, tools, safety instructions, and know-how to do a job properly and safely. If a condition is described, DO NOT assume that the bulletin applies to your vehicle, or that

your vehicle will have that condition. See your GM dealer for information on whether your vehicle may benefit from the information.



WE SUPPORT VOLUNTARY TECHNICIAN CERTIFICATION