



# Service Bulletin

## PRELIMINARY INFORMATION

**Subject:** (EREV) DTC P0335 and Or P0336 Stored In The HPCM

**Models:** 2011-2013 Chevrolet Volt

2012-2013 Opel Ampera

*This PI was superseded to update recommendations. Please discard PIP4880B.*

The following diagnosis might be helpful if the vehicle exhibits the symptom(s) described in this PI.

### Condition/Concern

Customer may comment of a MIL, dealer technician may find history DTC P0335 and or P0336 stored in the HPCM.

### Recommendation/Instructions

If the DTCs P0335 and or P0336 are found stored ONLY as history in the HPCM, please check ground connection G106 & G113.

If both grounds are clean and tight, attempt to reproduce the DTCs. If the DTCs do not reset please clear the DTCs and do not attempt any repairs at this time.

If either of the DTCs P0335 and P0336 are stored in the ECM as well as the HPCM or are current, please follow published SI diagnostics.

### Warranty Information

For vehicles repaired under warranty use:

Labor Operation	Description	Labor Time
J9999	Powertrain Controls — Labor Only Verify DTC Does Not Reset And Release Vehicle	Use published labor time

Please follow this diagnostic or repair process thoroughly and complete each step. If the condition exhibited is resolved without completing every step, the remaining steps do not need to be performed.

GM bulletins are intended for use by professional technicians, NOT a "do-it-yourselfer". They are written to inform these technicians of conditions that may occur on some vehicles, or to provide information that could assist in the proper service of a vehicle. Properly trained technicians have the equipment, tools, safety instructions, and know-how to do a job properly and safely. If a condition is described, DO NOT assume that the bulletin applies to your vehicle, or that your vehicle will have that condition. See your GM dealer for information on whether your vehicle may benefit from the information.



WE SUPPORT VOLUNTARY TECHNICIAN CERTIFICATION