



Service Bulletin

PRELIMINARY INFORMATION

Subject: SES MIL DTC P0442

Models: 2010 - 2012 Buick LaCrosse
Equipped with 3.0L (RPO LF1) or 3.6L (RPO LLT)

The following diagnosis might be helpful if the vehicle exhibits the symptom(s) described in this PI.


Condition/Concern


SES MIL illuminated with a DTC P0442 setting.

Recommendation/Instructions

Visually inspect evaporative pipe for contact with the throttle body. If contact is present, replace the evaporative pipe as needed and secure to eliminate future contact. Clear DTCs.

Note: The new evaporative pipe will have a conduit installed in the area of concern of the original pipe. Reference photos below.

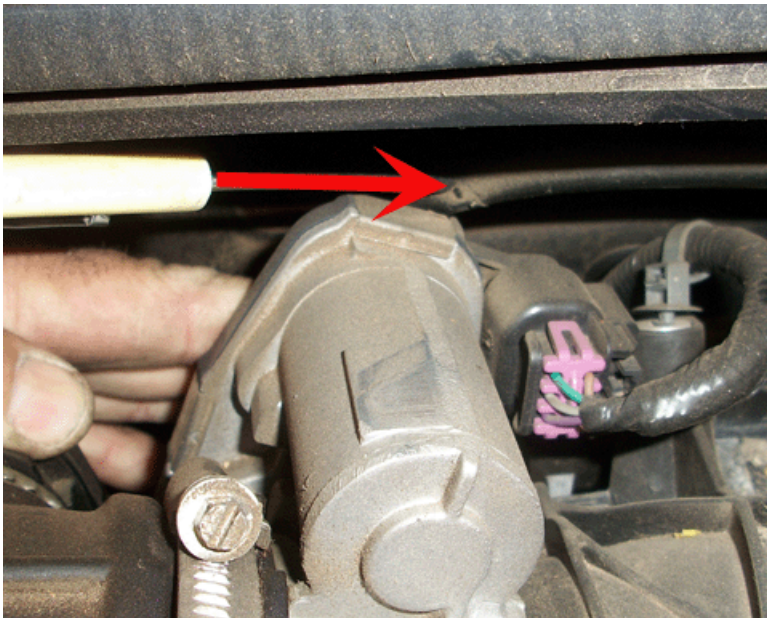

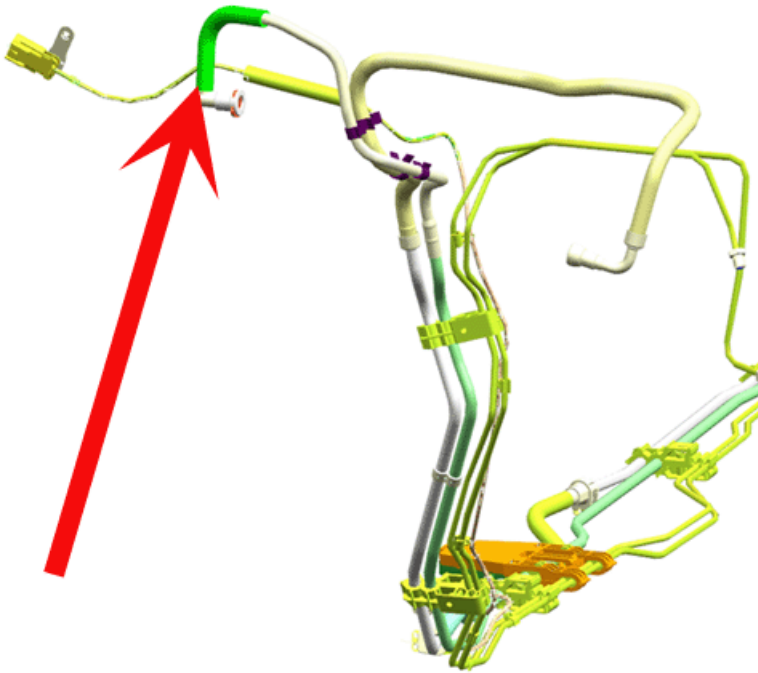

Warranty Information

For vehicles repaired under warranty use:

Labor Operation	Description	Labor Time
4025730	Evaporative Emission Canister Purge Pipe Replacement	Use Published Labor Operation Time

Please follow this diagnostic or repair process thoroughly and complete each step. If the condition exhibited is resolved without completing every step, the remaining steps do not need to be performed.

GM bulletins are intended for use by professional technicians, NOT a "do-it-yourselfer". They are written to inform these technicians of conditions that may occur on some vehicles, or to provide information that could assist in the proper service of a vehicle. Properly trained technicians have the equipment, tools, safety instructions, and know-how to do a job properly and safely. If a condition is described, DO NOT assume that the bulletin applies to your vehicle, or that your vehicle will have that condition. See your GM dealer for information on whether your vehicle may benefit from the information.



WE SUPPORT VOLUNTARY TECHNICIAN CERTIFICATION