



Service Bulletin

PRELIMINARY INFORMATION

Subject: Folding Top Leans To One Side During Top Cycle

Models: 2011 - 2013 Chevrolet Camaro Convertible

The following diagnosis might be helpful if the vehicle exhibits the symptom(s) described in this PI.

Condition/Concern

A customer may comment the convertible folding top leans to one side when opening or closing the roof. This condition could be caused by a ball socket that has separated from either the left or right hydraulic cylinder.

Recommendation/Instructions

Inspect the hydraulic cylinders for proper attachment to the folding top frame assembly. If the cylinder has separated from the folding top frame, replace the retainer and reinstall the cylinder to the frame assembly.

Parts Information

Part Number	Description	Qty
11611829	Clip	As Needed

Warranty Information

For vehicles repaired under warranty use:

Labor Operation	Description	Labor Time
*6080028	Replace Folding Top Cylinder Retainer / Clip	0.5 hr
* This is a unique labor operation for bulletin use only. It will not be published in the Labor Time Guide.		

Please follow this diagnostic or repair process thoroughly and complete each step. If the condition exhibited is resolved without completing every step, the remaining steps do not need to be performed.

GM bulletins are intended for use by professional technicians, NOT a "do-it-yourselfer". They are written to inform these technicians of conditions that may occur on some vehicles, or to provide information that could assist in the proper service of a vehicle. Properly trained technicians have the equipment, tools, safety instructions, and know-how to do a job properly and safely. If a condition is described, DO NOT assume that the bulletin applies to your vehicle, or that your vehicle will have that condition. See your GM dealer for information on whether your vehicle may benefit from the information.



WE SUPPORT VOLUNTARY TECHNICIAN CERTIFICATION