



Service Bulletin

PRELIMINARY INFORMATION

Subject: SES Lamp On With DTC P2270

Models: 2013 Chevrolet Silverado
2013 GMC Sierra
Built with 4.8L 5.3L 6.0L RPO L20 LC9 LMG L96

This PI was superseded to add the Silao assembly plant. Please discard PIP5123A.

The following diagnosis might be helpful if the vehicle exhibits the symptom(s) described in this PI.

Condition/Concern

Concern of DTC P2270 setting along with any of the following codes P0140, P0139, P0138, P0137, P013A, P013B on vehicles built at the Fort Wayne and/or Silao assembly plants during January or February of 2013.

Recommendation/Instructions

Check connector X131 for a bent terminal F as indicated in the attached PIC and repair per SI procedures.



If no connector issue is found, follow SI diagnostics.

Warranty Information

For wiring repairs covered under warranty, please refer to latest version of bulletin 10-00-89-005 for warranty information on wire/connector repairs.

Please follow this diagnostic or repair process thoroughly and complete each step. If the condition exhibited is resolved without completing every step, the remaining steps do not need to be performed.

GM bulletins are intended for use by professional technicians, NOT a "do-it-yourselfer". They are written to inform these technicians of conditions that may occur on some vehicles, or to provide information that could assist in the proper service of a vehicle. Properly trained technicians have the equipment, tools,

safety instructions, and know-how to do a job properly and safely. If a condition is described, DO NOT assume that the bulletin applies to your vehicle, or that your vehicle will have that condition. See your GM dealer for information on whether your vehicle may benefit from the information.



WE SUPPORT VOLUNTARY TECHNICIAN CERTIFICATION