



Service Bulletin

PRELIMINARY INFORMATION

Subject: Center Seat Accessory Power Outlet Inoperative (Inspect Fuse F1DR 15 amp)

Models: 2014 Chevrolet Silverado 1500

2014 GMC Sierra 1500

The following diagnosis might be helpful if the vehicle exhibits the symptom(s) described in this PI.

Condition/Concern

Some owners may comment the Center Seat (Armrest) Accessory Power Outlet (X80E) is inoperative. This power outlet is operational when the ignition is turned to either the run or the accessory positions. If the power outlet is inoperative in the run or accessory positions inspect the F1DR fuse (15 amp), located in the right I/P fuse block, for being blown.

Recommendation/Instructions

If the fuse is blown inspect for a short to ground on circuit 850 near the left pivot for the center seat armrest, as shown below. If the circuit is shorted repair as necessary and protect the harness so it does not reoccur.



Warranty Information

For wiring repairs covered under warranty, please refer to latest version of bulletin 10-00-89-005 for warranty information on wire/connector repairs.

Please follow this diagnostic or repair process thoroughly and complete each step. If the condition exhibited is resolved without completing every step, the remaining steps do not need to be performed.

GM bulletins are intended for use by professional technicians, NOT a "do-it-yourselfer". They are written to inform these technicians of conditions that may occur on some vehicles, or to provide information that could assist in the proper service of a vehicle. Properly trained technicians have the equipment, tools, safety instructions, and know-how to do a job properly and safely. If a condition is described, DO NOT assume that the bulletin applies to your vehicle, or that your vehicle will have that condition. See your GM dealer for information on whether your vehicle may benefit from the information.



WE SUPPORT VOLUNTARY TECHNICIAN CERTIFICATION