



Bulletin No.: PI1034

Date: Aug-2013

# Service Bulletin

## PRELIMINARY INFORMATION

**Subject:** Check Engine Light On with DTC P0442 Set

**Models:** 2014 Chevrolet Impala  
Equipped with 3.6L Engine (RPO LFX)

### Condition/Concern

Some customers may comment on a check engine light being on. The technician may find DTC P0442 set.



This condition is due to the seal on the fuel tank filler pipe housing not seated properly during vehicle assembly, causing a small EVAP leak and the seal to overlap the fuel tank filler neck as shown in the illustration above.

### Recommendation/Instructions

Using a trim stick, push the seal over the filler neck and clear the DTC.

### Warranty Information

For vehicles repaired under the U.S. (3 years / 36,000 miles) or Canadian (3 years / 60,000 km) Bumper-to-Bumper Warranty, use:

| Labor Operation  | Description   | Labor Time |
|--|---|------------|
| 1480118*   | Reposition the Fuel Tank Filler Pipe Housing Seal and Clear DTC | 0.4 hr     |
| *This is a unique labor operation for bulletin use only. It will not be published in the Labor Time Guide. |   |            |

GM bulletins are intended for use by professional technicians, NOT a "do-it-yourselfer". They are written to inform these technicians of conditions that may occur on some vehicles, or to provide information that could assist in the proper service of a vehicle. Properly trained technicians have the equipment, tools, safety instructions, and know-how to do a job properly and safely. If a condition is described, DO NOT assume that the bulletin applies to your vehicle, or that

your vehicle will have that condition. See your GM dealer for information on whether your vehicle may benefit from the information.



WE SUPPORT VOLUNTARY TECHNICIAN CERTIFICATION