



Service Bulletin

PRELIMINARY INFORMATION

Subject: Exhaust Rattle Noise

Models: 2011-2013 Chevrolet Camaro Convertible
Equipped with V8 Engine (RPO L99)


This PI has been revised to add the 2013 model year and update the Labor Operation to the Global Labor Code (GLC). Please discard PI0807A.

Condition/Concern

Some customers may comment on an exhaust rattle or noise when at idle or slow vehicle speeds up to 1300 engine rpm.

The spring in the exhaust valve may be causing the exhaust to rattle or make noise.

Recommendation/Instructions

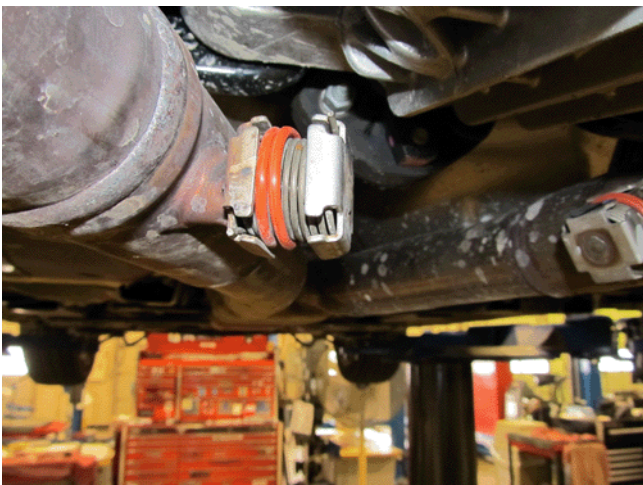

Technicians should follow the procedure below and install two silicone O-rings over each of the exhaust valve springs to dampen the rattle.

1. Raise the vehicle.
2. Install two O-rings onto the left exhaust valve spring.
3. Install two O-rings onto the right exhaust valve spring.
4. Lower the vehicle.

Parts Information

Part Number	Description	Quantity
23105943	DAMPENER EXH PIPE (O-RING)	4

Warranty Information

For vehicles repaired under warranty, use:

Labor Operation	Description	Labor Time
4080158*	Install O-rings to Exhaust Springs	0.2 hr

*This is a unique labor operation for bulletin use only. It will not be published in the Labor Time Guide.

GM bulletins are intended for use by professional technicians, NOT a "do-it-yourselfer". They are written to inform these technicians of conditions that may occur on some vehicles, or to provide information that could assist in the proper service of a vehicle. Properly trained technicians have the equipment, tools, safety instructions, and know-how to do a job properly and safely. If a condition is described, DO NOT assume that the bulletin applies to your vehicle, or that your vehicle will have that condition. See your GM dealer for information on whether your vehicle may benefit from the information.



WE SUPPORT VOLUNTARY TECHNICIAN CERTIFICATION