

Date: 10/05/2013

Subject: PLEXIGLAS SUPPORT VIBRATION

Models: MULTISTRADA 1200 MODEL YEAR 2013 (all versions)


- **Technical problem**

The Multistrada 1200 Model Year 2013 belonging to the first produced lot could feature a vibration in the Plexiglas support when riding the bike.

The play that could cause such vibration can be also checked with stopped motorcycle.


- **Technical problem solution**

To prevent this, replace original equipment **rubber pad (1)** placed between **special screw (3)** and **bushing (2)** with a new rubber pad (part. no. 86611132A).

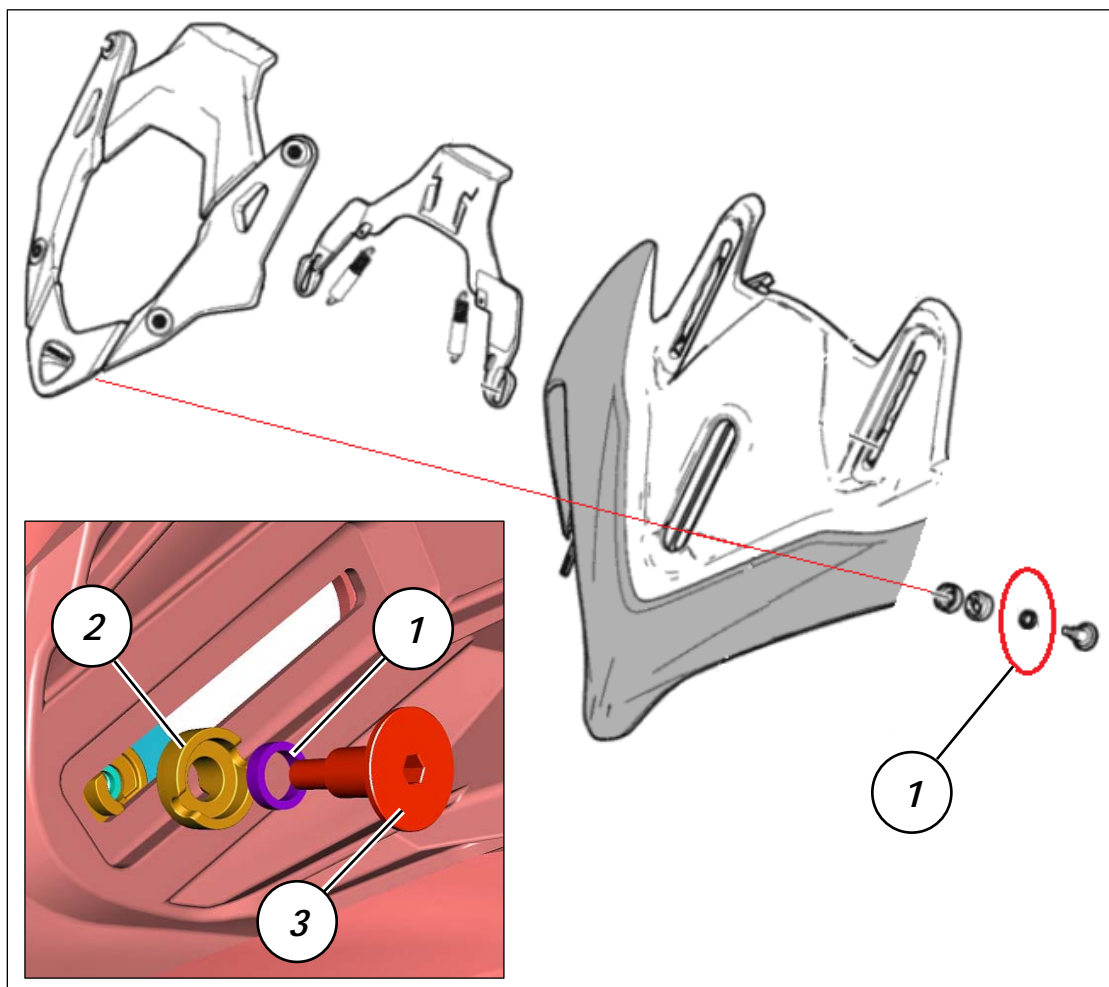



The new rubber pad (part. no. 86611132A) can be distinguished from the one supplied with the original equipment (external diameter 11.5 mm) as it features a larger external diameter (the external diameter being now 13.5 mm):

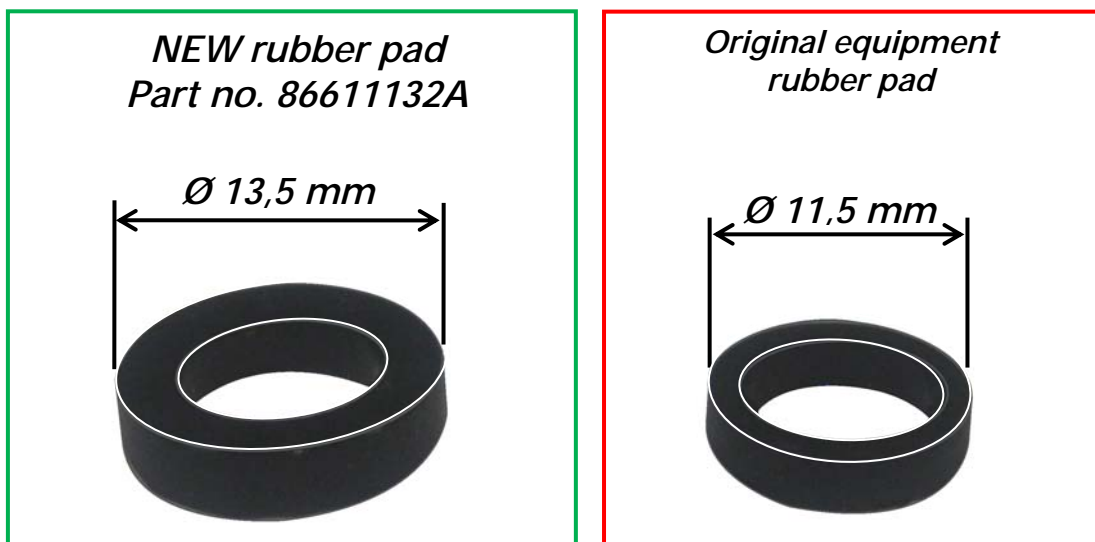

Remove the bike headlight fairing to reach the Special screw (3). Afterwards tighten such screw to a torque of 5 Nm ± 10%.

The new rubber pad - part no. 86611132A. - has been introduced on the production line starting from VIN no. ZDMA300AADB005278.

Best regards.

Luca Crucianelli
Service Technical Specialist

Francesco Penazzo
Service Aftersales Manager