



Service Bulletin

PRELIMINARY INFORMATION

Subject: Malfunction Indicator Lamp (MIL) On, DTCs P059F and/or P069E Set

Models: 2013 Chevrolet Malibu Built After July 24, 2013
2014 Chevrolet Malibu Built Prior to September 21, 2013
Equipped with Front Lower Grille Shutters (RPO VRI)

Condition/Concern

Some customers may comment that the malfunction indicator lamp (MIL) is on.

When checking the vehicle for DTCs, P059F and/or P069E may be set.

The MIL may illuminate if the drive louver (louver connected to actuator) has over-rotated past its stop. When this occurs, the actuator becomes out of range.

Recommendation/Instructions

A new shutter assembly with revised actuator calibrations is now available to correct this condition. Technicians should replace the shutter assembly. Refer to the Front Bumper Fascia Air Deflector Replacement procedure in SI.

Parts Information

Part Number	Description
23183782 (2013 Model Year)	Shutter Assembly, Front Bumper
23183781 (2014 Model Year)	Shutter Assembly, Front Bumper

Warranty Information

For vehicles repaired under warranty, use:

Labor Operation	Description	Labor Time
1421020	Front Bumper Fascia Air Deflector Replacement	Use Published Labor Operation Time

GM bulletins are intended for use by professional technicians, NOT a "do-it-yourselfer". They are written to inform these technicians of conditions that may occur on some vehicles, or to provide information that could assist in the proper service of a vehicle. Properly trained technicians have the equipment, tools, safety instructions, and know-how to do a job properly and safely. If a condition is described, DO NOT assume that the bulletin applies to your vehicle, or that your vehicle will have that condition. See your GM dealer for information on whether your vehicle may benefit from the information.



WE SUPPORT VOLUNTARY TECHNICIAN CERTIFICATION